

FOREST RIVER WARRANTY CLAIM FORM

DEALER ACCOUNT #	0008794	CLAIM STATUS	Authorized
MYERS RV CENTER INC		CLAIM	2547739
12024 CENTRAL AVE S.E.		CLAIM ORIGIN	WEB
ALBUQUERQUE, NM 87123		ORIGINAL CLAIM ID	
USA		VIN	5ZT2TRHB2SB525920
		CHASSIS VIN	
		MILEAGE	0
Labor rate:	\$190.00	SITE/WAREHOUSE	048 / 048B
OWNER INFORMATION		ITEM #	TRT190RB
LINDA CECIL		DEALER RO #	72745
2728 DECKER AVE NW		CLAIM START DATE	01/12/2026
Albuquerque, NM 87107		CLAIM END DATE	01/01/1900
USA			
Retail Date of Purchase	10/09/2025	WARRANTY EXPIRATION DATE	10/09/2026

Claim Line Details

Labor

Line# 1	Operation Code	Operational Description
	10-38-28-00-000497	Lippert Schwintek In-Wall Slide Out Column - complete, per side - Frame & Chassis/Slide Out System (Lippert Schwintek)/Align/No Tread Code

Complaint, Cause, Correction

Original Note : stephanie@dealer-advisors.com, 2026-01-12 12:06:04 :: Jobs have been separated out per request from Tony Dile on PA 2545052. All lines are related to job 1. Complaint: Customer states rear slide column is separating from sidewall at rear exterior Cause: Screws have pulled out of fiberglass Correction: Where the screws pulled out of the fiberglass there are spider cracks in the fiberglass that extend past the H column. We will have to remove the H column on the one side after bracing the slide out, will have to have fiberglass repaired and painted. Also, there are two screws that pulled out in the lower black decal which will also need to be replaced. In order for decal to be replaced the outside shower, black tank flush and the city water connection need to be removed. Once all of that is removed, I can scrape the decal and install the new decal which will need to have the openings cuts for the plumbing. Reconnect the plumbing, reinstall outside shower, reseal with clear silicone. Will need to pressure test to ensure there are no leaks. Once slide is able to be reinstalled, I will have to pre-drill holes through the H column into the wall in between all of the existing holes in order to securely install this slide. In addition to screws, I would install a bolt one at the bottom of each H column that goes all the way through the wall to the inside, so we can actually bolt into the structure. Labor time breakdown is as follows .3 to r/i city water connection - see job 2 .3 to r/i black tank flush connection - see job 3 .8 r/i outside shower box - see job 4 1.0 decal replacement - see job 5 .5 slide removal and bracing for body work - see job 1 1.3 realign, predrill, reinstall slide, seal open holes with black silicone - see job 1 1.0 to install thru bolts in bottom corners of slide room - see job 1 .5 to pressure test - see job 3

Model#	Dlr Sub Hrs	3.00	Sub Labor Amt \$570.00
Serial#	Appr Hrs	2.00	Appr Labor Amt \$380.00

Notes

What is this claim for? The schwintek columns are screwed in, not bolted. Thank you Dp. This is for the slide removal and bracing for body work, realigning and predrilling and then reinstalling the slide and to seal the open hole with black silicone. Tech stated in addition to the screws he would add the bolts so that it goes all the way through the wall to the inside through the structure. It sounds like its being done as an additional measure to secure it and not have the screws pull out again. NVCB,R&RI and secure to OEM specs.Per dealers description of this repair. This authorization is pending ALL requirements of repair code have been met.TD

Labor

Line# 2	Operation Code	Operational Description
	60-136-01-00-001480	City Water Connection - Plumbing/Fresh Water Supply/Replace/No Tread Code

Complaint, Cause, Correction

Original Note : stephanie@dealer-advisors.com, 2026-01-12 12:10:14 :: Complaint: Rear slide column separating from sidewall at rear exterior Cause: Decal was damaged and in order to replace will need to pull city water connection Correction: r/i city water connection

Model#	Dlr Sub Hrs	0.30	Sub Labor Amt \$57.00
---------------	--------------------	------	------------------------------

20-53-24-00-000602

Fiberglass Delamination - Exterior/Fiberglass Sidewall/Repair/No Tread Code

Complaint, Cause, Correction

Original Note : stephanie@dealer-advisors.com, 2026-01-12 12:18:42 :: Complaint: Spider cracks where the screws pulled out of the fiberglass on job 1. Cause: Screws pulled out of fiberglass Correction: Sublet for repair to fiberglass and painting

Model#	Dlr Sub Hrs	0.00	Sub Labor Amt	\$1,226.00
Serial#	Appr Hrs	0.00	Appr Labor Amt	\$1,226.00

Notes

This is under management review, please acknowledge this claim to place it back on our siode for further review. Thank you Dp.

Can you please send me a pic of the whole area (a full pic of the coach where the small pics came from with the damage circled)TD

Added some additional photos

NVCB,Per dealers description of this repair. This authorization is pending ALL requirements of repair code have been met.TD

Submitted	Labor Amt	\$2,347.00	Approved	Labor Amt	\$1,910.00
	Parts & Freight	\$0.00		Parts & Freight	\$0.00
	Total	\$2,347.00		Total	\$1,910.00

DEALER **DATE**
SIGNATURE
 I certify that I have performed these repairs consistent with Forest River Policies.

CUSTOMER **DATE**
SIGNATURE
 All repairs described have been inspected and are satisfactory.