



12024 Central Ave SE ★ Albuquerque NM 87123
www.MYERSRV.com
(505)298-7691 ★ 1-800-748-2078 ★ FAX (505)293-7172

W/O: 72768-1
Promised Date:
20 JAN 26



WO #: 72768-1

Customer Name: 1000 - MYERS "RV"
CENTER, INC.

Completed Date:
Invoice#:
Author: ADVISOR
Stock Desc: 9652 2026 AVENGER 27REI
Serial#: 941670
Chassis#: 5ZT2AVSB2TB941670
Miles/Hrs:
Tag#:
Purchased Date:
Warranty Date:

Date In: 23 JAN 26
Time In:

Job #01 - Warranty

COMPLAINT: Entertainment Center, Hideaway door pulled from door jam

CAUSE: Pantry door came loose on hinge side falling and scraping the shelves inside

CORRECTION: TV, fireplace, door, and plastic door jam had to be removed along with panels on each side, found the support on backer for the door and hinges was not enough to support the door. Added new stud and screwed into place. Reattached paneling on both sides, reinstalled plastic door jam, reinstalled door and tested for proper operation. The door now opens and closed properly. Reinstalled the fireplace and TV. Touched up all nicks and scratches, verified the latch was working. Reattached power cable with a zip tie. Time 1 hour

Labor

Job #	Description	Total
01	MISC LABOUR CODE (WARRANTY)	N/C

Parts

Part #	Description	Qty	Price	Total
7725	LIQUID NAILS	1.00	N/C	N/C
9999	STUD	1.00	N/C	N/C

Subtotal for Job #01: 0.00

Job #02 - Warranty

COMPLAINT: Bedroom pocket door pulled from ceiling

CAUSE: Found door was not secure during transport, hit the wall scratching the door and causing minor damage to the wall. Barn door rail loose causing nicks and scratches to the wall and door

CORRECTION: Found screws loose on top rail of the barn door. Tightened screws and added 4 additional screws.

Checked operation of door is now working correctly and rail is secure
Found a screw hole in the barn door rail trim.

Used putty stick to fill the crack in the wall and the screw hole

Used touch up stain on the scratch on door. Work completed

Time 1 hour

Time 1 hour

Customer #: 1000
MYERS "RV" CENTER,
INC.,





Labor		
Job #	Description	Total
02	MISC LABOUR CODE (WARRANTY)	N/C
Subtotal for Job #02:		0.00

Job #03 - Warranty

COMPLAINT: Seam tape at kitchen wall peeling at two separate areas

CAUSE: Seam tape behind kitchen sink peeling

CORRECTION: Seam tape behind kitchen sink has been replaced. Removed, cleaned and replaced seam tape.

Time .5 hours

Labor		
Job #	Description	Total
03	MISC LABOUR CODE (WARRANTY)	N/C
Subtotal for Job #03:		0.00

Job #04 - Warranty

COMPLAINT: Center Batin strip wallpapers peeling in dinette slide room

CAUSE: Wall paper coming off batten trim

CORRECTION: Removed batten trim

Replaced with new trim

.10 hours

Labor		
Job #	Description	Total
04	MISC LABOUR CODE (WARRANTY)	N/C
Subtotal for Job #04:		0.00

Job #05 - Warranty

COMPLAINT: Wallpaper cut crooked at forward dinette slide wall

CAUSE: Gap in wallpaper at batten trim

CORRECTION: Siliconed the edges between batten and wall

Time .10 hours

Labor		
Job #	Description	Total
05	MISC LABOUR CODE (WARRANTY)	N/C

Parts				
Part #	Description	Qty	Price	Total
8867	ALMOND SILICONE	1.00	N/C	N/C
Subtotal for Job #05:				0.00

Job #06 - Warranty

COMPLAINT: Excessive wood putty, and construction stain on walls, ceilings, and cabinet doors

CAUSE: Excessive putty and missing putty glue and silicone on the walls and ceiling

CORRECTION: Found excessive putty on the ceiling and walls throughout the unit

Found in the front bedroom there was adhesive on the ceiling and wall

Found silicone on the wall above the passenger slide

Wiped down all excessive putty from the walls and ceiling

Filled the staple holes that were missing putty



Scrubbed the adhesive off the ceiling and wall in the bedroom
Scrubbed the black marks off the ceiling in hallway and Main room
Work completed
Time 1 hour

Labor

Job #	Description	Total
06	MISC LABOUR CODE (WARRANTY)	N/C

Subtotal for Job #06: 0.00

Job #07 - Warranty

COMPLAINT: Missing red battery disconnect plug

CAUSE: Battery disconnect red key is missing

CORRECTION: Disconnect key missing need to order new one
Hold for parts

Labor

Job #	Description	Total
07	MISC LABOUR CODE (WARRANTY)	N/C

Subtotal for Job #07: 0.00

Job #09 - Warranty

COMPLAINT: Water leak

CAUSE: Water leak cold water line

CORRECTION: Line repaired unit has been winterized will need to verify and leak test during SFD Time .30

Labor

Job #	Description	Total
09	Water leak at underbelly in front of front axle	N/C

Subtotal for Job #09: 0.00

Job #10 - Warranty

COMPLAINT: Anti-siphon valve and access panel under bathroom sink

CAUSE: Anti-siphon valve for black tank flush malfunctioning

CORRECTION: Found the anti-siphon valve under the bathroom sink was not working correctly
The access panel under the bathroom sink had come apart.
Disconnected the zip tie holding the anti-siphon valve. Removed the valve and installed new one.
Removed the base for the access panel
Pulled all the old staples
Re-stapled the base to the panel and installed the access panel
Work completed
Time 45 minutes

Labor

Job #	Description	Total
10	Black tank flush dose not work	N/C

Parts

Part #	Description	Qty	Price	Total
55-5289	FRESH WATER VACUUM BREAKER	1.00	N/C	N/C

W/O: 72768-1
Promised Date: 28 JAN 26



Customer #: 1000
MYERS "RV" CENTER,
INC.,



W/O: 72768-1
Promised Date: 28 JAN 26



Customer #: 1000
MYERS "RV" CENTER,
INC.,



Subtotal for Job #10: 0.00

Job #11 - Warranty

COMPLAINT: Cracked caulking around counter top

CAUSE: Cracked caulking counter top edge at kitchen sink

CORRECTION: Removed the cracked caulking on the counter top. Cleaned and reapplied with white silicone

Work complete. Time .30

Labor

Job #	Description	Total
11	MISC LABOUR CODE (WARRANTY)	N/C

Subtotal for Job #11: 0.00

Job #12 - Warranty

COMPLAINT: Medicine cabinet doors not aligned

CAUSE: Medicine cabinet doors too close together and hitting each other

CORRECTION: Moved the right cabinet door 1/8 inch to the right by removing the hinge screws the reattaching the door ensuring the doors were even

Moved the door catch over on the left an 1/8 inch.

Doors now aligned and work correctly

Work completed

Time 30 minutes

Labor

Job #	Description	Total
12	MISC LABOUR CODE (WARRANTY)	N/C

Subtotal for Job #12: 0.00

Parts Total: 0.00

Labour Total: 0.00

Sublet Total: 0.00

Extras Total: 0.00

WORK ORDER TOTAL: 0.00

NOTICE:
DUE TO A LACK OF SPACE, A \$15/DAY STORAGE FEE WILL APPLY IF YOU DO NOT PICK UP YOUR UNIT WITHIN 48 HOURS OF NOTICE OF COMPLETION

EFFECTIVE 01/12/2026 A CREDIT CARD SURCHARGE OF 3% WILL BE APPLIED TO ALL CREDIT CARD TRANSACTIONS

MANUFACTURER'S WARRANTIES AND SERVICE CONTRACTS DO NOT COVER DIAGNOSTIC TIME IF NO PROBLEM IS FOUND

ALTHOUGH WE TAKE PRECAUTIONS TO INSURE YOUR VEHICLE'S SECURITY WHILE IN FOR REPAIRS, WE ARE NOT RESPONSIBLE FOR ANY LOSS OR DAMAGE TO THE VEHICLE OR CONTENTS DUE TO FIRE, THEFT, OR ANY OTHER CAUSE BEYOND OUR CONTROL. WE WOULD APPRECIATE YOUR ASSISTANCE BY REMOVING OR SECURING YOUR VALUABLES SUCH AS GUNS, CAMERAS, JEWELRY, CASH, ETC.

I hereby authorize Myers RV Center, Inc. to perform the repair work set forth in this work order, including the parts and materials necessary. I agree that you are not responsible for delays caused by unavailability of parts or delays in parts shipments by the supplier or transporter. I hereby grant you and/or your employees permission to operate the vehicle herein described on streets and highways for the purpose of testing, inspection or transporting to sublet vendors. An express mechanics lien is hereby acknowledged on the herein described vehicle to secure the payment for repairs performed.

Customer Signature : _____

Date: 30 Jan 2026

