

DEALER ACCOUNT #	0008794	CLAIM STATUS	Paid
MYERS RV CENTER INC		CLAIM	2566700
12024 CENTRAL AVE S.E.		CLAIM ORIGIN	WEB
ALBUQUERQUE, NM 87123		ORIGINAL CLAIM ID	
USA		VIN	5ZT2AVSB2TB941670
		CHASSIS VIN	
		MILEAGE	0
Labor rate:	\$190.00	SITE/WAREHOUSE	050 / 050
OWNER INFORMATION		ITEM #	AVT27REI
		DEALER RO #	72768-1
		CLAIM START DATE	01/30/2026
		CLAIM END DATE	02/24/2026
Retail Date of Purchase		WARRANTY EXPIRATION DATE	

Labor

Line# 1	Operation Code 30-101-24-00-001074	Operational Description Interior Door Jamb, U-Channel, Casing, Frame - Interior/Interior Doors/Repair/No Tread Code
Complaint, Cause, Correction Original Note : stephanie@dealer-advisors.com, 2026-01-30 15:03:21 :: Complaint: Entertainment center, hideaway door is pulled from door jamb Cause: Pantry door came loose on hinge side falling and scraping shelves inside Correction: TV, fireplace, door and plastic door jam had to be removed along with panels on each side. Found the support on backer for the door and hanges was not enough support for the door. Added new stud and screwed into place. Reattached paneling on both side, reinstalled plastic door jam, reinstalled door and tested for proper operation. The door now opens and closes properly. Reinstalled the fire place and TV. Touched up all nicks and scratches, verified the latch was working. Reattached power cable with a zip tie.		
Model#	Dlr Sub Hrs	1.00 Sub Labor Amt \$190.00
Serial#	Appr Hrs	1.00 Appr Labor Amt \$190.00
Notes NVCB, to rebuild with new stud . Per dealers description of this repair. This authorization is pending ALL requirements of repair code have been met.TD		

Part

Line# 1	Item #		Description			
	USERPART		Liquid Nails			
	Model #		Serial #		Part tag	
	Sub Qty	1.00	Sub Dlr Price	\$3.50	Sub Freight	\$0.00
	Appr Qty	1.00	Appr Dlr Price	\$3.50	Appr Freight	\$0.00
	Notes					
Line# 2	Item #		Description			
	USERPART		Stud			
	Model #		Serial #		Part tag	
	Sub Qty	1.00	Sub Dlr Price	\$9.99	Sub Freight	\$0.00
	Appr Qty	1.00	Appr Dlr Price	\$9.99	Appr Freight	\$0.00
	Notes					

Labor

Line# 2	Operation Code	Operational Description
	30-101-24-00-001078	Sliding, Pocket Door - Interior/Interior Doors/Repair/No Tread Code
	Complaint, Cause, Correction	
	Original Note : stephanie@dealer-advisors.com, 2026-01-30 15:08:42 :: Complaint: Bedroom pocket door pulled from the ceiling Cause: Found door was not secure during transport, hit the wall scratching the door and causing minor damage to the wall. barn door rail is loose causing nicks and scratches to the wall and door. Correction:	

Found screws loose on top rail of barn door. Tightened screws and added 4 additional screws. Checked operation of door, it is not working correctly and rail is secure. Found a screw hole in the barn door rail trim. Used a putty stick to fill the crack in the wall and the screw hole. Used touchup stain on scratch on door.

Model#	Dlr Sub Hrs	1.00	Sub Labor Amt	\$190.00
Serial#	Appr Hrs	1.00	Appr Labor Amt	\$190.00

Notes

NVCB, R&RI door resecure track and youch up damages. Per dealers description of this repair. This authorization is pending ALL requirements of repair code have been met. TD been met

Part

Line# 1	Item #	Description			
	USERPART	4 Screws, putty stick, touch up stain			
	Model #	Serial #	Part tag		
	Sub Qty	1.00	Sub Dlr Price	\$9.50	Sub Freight \$0.00
	Appr Qty	1.00	Appr Dlr Price	\$9.50	Appr Freight \$0.00

Notes

Labor

Line# 3	Operation Code	Operational Description
	30-102-01-00-001097	Seam Tape, per 8 ft. Strip - Interior/Panels, Ceilings, & Interior Moldings/Replace/No Tread Code

Complaint, Cause, Correction

Original Note : stephanie@dealer-advisors.com, 2026-01-30 15:10:25 :: Complaint: Seam tape at kitchen wall peeling at two separate areas Cause: Seam tape behind kitchen sink is peeling Correction: Seam tape behind kitchen sink needs to be replaced.

Model#	Dlr Sub Hrs	0.50	Sub Labor Amt	\$95.00
Serial#	Appr Hrs	0.50	Appr Labor Amt	\$95.00

Notes

NVCB, R&RI recept and R&R 2 seam tapes.Per dealers description of this repair. This authorization is pending ALL requirements of repair code have been met.TD

Part

Line# 1	Item #	Description			
	USERPART	Seam Tape			
	Model #	Serial #	Part tag		
	Sub Qty	1.00	Sub Dlr Price	\$4.75	Sub Freight \$0.00
	Appr Qty	1.00	Appr Dlr Price	\$4.75	Appr Freight \$0.00

Notes

Labor

Line# 4	Operation Code	Operational Description
	30-102-01-00-001116	Ceiling Battens, each - Interior/Panels, Ceilings, & Interior Moldings/Replace/No Tread Code

Complaint, Cause, Correction

Original Note : stephanie@dealer-advisors.com, 2026-01-30 15:11:35 :: Complaint: Center batten strip wallpapers peeling in dinette slide room Cause: Wallpaper is coming off batten trim Correction: Removed batten trim and replace

Model#	Dlr Sub Hrs	0.20	Sub Labor Amt	\$38.00
Serial#	Appr Hrs	0.20	Appr Labor Amt	\$38.00

Notes

Part

Line# 1	Item #	Description			
	USERPART	Batten Trim			
	Model #	Serial #	Part tag		
	Sub Qty	1.00	Sub Dlr Price	\$1.90	Sub Freight \$0.00
	Appr Qty	1.00	Appr Dlr Price	\$1.90	Appr Freight \$0.00

Notes

Labor

Line# 5	Operation Code 30-102-24-00-001117	Operational Description Trim Molding, each - Interior/Panels, Ceilings, & Interior Moldings/Repair/No Tread Code
Complaint, Cause, Correction Original Note : stephanie@dealer-advisors.com, 2026-01-30 15:12:41 :: Complaint: Wallpaper cut crooked at forward dinette slide wall Cause" Gap in wallpaper at batten trim Correction: Silicone the edges between batten and wall		
Model#	Dlr Sub Hrs 0.10	Sub Labor Amt \$19.00
Serial#	Appr Hrs 0.10	Appr Labor Amt \$19.00
Notes		

Part

Line# 1	Item #		Description			
	USERPART		Almond Silicone			
	Model #		Serial #		Part tag	
	Sub Qty	1.00	Sub Dlr Price	\$11.18	Sub Freight	\$0.00
	Appr Qty	1.00	Appr Dlr Price	\$11.18	Appr Freight	\$0.00
	Notes					

Labor

Line# 6	Operation Code 30-102-24-00-001094	Operational Description Wall Panel Touch up - Luan - Interior/Panels, Ceilings, & Interior Moldings/Repair/No Tread Code
Complaint, Cause, Correction Original Note : stephanie@dealer-advisors.com, 2026-01-30 15:20:56 :: Complaint: Excessive wood putty and construction stains on the walls, ceilings and cabinet doors Cause: Excessive putty and missing putty glue and silicone on the walls and ceiling. Found excessive putty on the ceiling and walls throughout the unit. Found in the front bedroom there was adhesive on the ceiling and wall. Found silicone on the wall above the passenger slide. Correction: Wiped down all excessive putty from the walls and ceiling and filled the staple holes that were missing putty.		
Model#	Dlr Sub Hrs 1.00	Sub Labor Amt \$190.00
Serial#	Appr Hrs 1.00	Appr Labor Amt \$190.00
Notes NVCB, For 5 touch up areas.Per dealers description of this repair. This authorization is pending ALL requirements of repair code have been met.TD		

Part

Line# 1	Item #		Description			
	USERPART		Putty			
	Model #		Serial #		Part tag	
	Sub Qty	1.00	Sub Dlr Price	\$1.90	Sub Freight	\$0.00
	Appr Qty	1.00	Appr Dlr Price	\$1.90	Appr Freight	\$0.00
	Notes					

Labor

Line# 7	Operation Code 40-109-01-00-004167	Operational Description Battery Disconnect Relay Switch - Electrical/Ignition Charging System/Replace/No Tread Code
Complaint, Cause, Correction Original Note : stephanie@dealer-advisors.com, 2026-01-30 15:22:50 :: Complaint: Missing red battery disconnect plug Cause: Battery disconnect red key is missing Correction: Need to replace the missing disconnect key		
Model#	Dlr Sub Hrs 0.25	Sub Labor Amt \$47.50
Serial#	Appr Hrs 0.25	Appr Labor Amt \$47.50
Notes NVCB, Per dealers description of this repair. This authorization is pending ALL requirements of repair code have been met.TD		

Part

Line# 1	Item #	Description			
	F100718405	BATTERY DISCONNECT, SWITCH SIGMSW, SP0179-15-A0306/BLACK, 35875			
	Model #	Serial #	Part tag	0000403461	
	Sub Qty	1.00	Sub Dlr Price	\$15.52	Sub Freight \$16.30
	Appr Qty	1.00	Appr Dlr Price	\$15.52	Appr Freight \$16.30

Notes

Labor

Line# 8	Operation Code	Operational Description			
	60-136-15-00-001499	Water Line - Plumbing/Fresh Water Supply/Repair or Replace/No Tread Code			
	Complaint, Cause, Correction				
	Original Note : stephanie@dealer-advisors.com, 2026-01-30 15:23:41 :: Complaint: There is a water leak. Cause: Water leak at cold water line Correction: Repair line				
	Model#	Dlr Sub Hrs	0.30	Sub Labor Amt	\$57.00
	Serial#	Appr Hrs	0.30	Appr Labor Amt	\$57.00

Notes
NVCB, Per dealers description of this repair. This authorization is pending ALL requirements of repair code have been met.TD

Labor

Line# 9	Operation Code	Operational Description			
	60-138-01-00-001536	Vacuum Breaker - 1.5" Anti-Siphon Vent - Plumbing/Drainage System/Replace/ No Tread Code			
	Complaint, Cause, Correction				
	Original Note : stephanie@dealer-advisors.com, 2026-01-30 15:26:09 :: Complaint: Anti siphon valve and access panel under bathroom sink malfunctioning Cause: Found the anti siphon valve under the bathroom sink was not working correctly. Access panel under bathroom sink had come apart. Disconnected the zip tie holding the anti siphon valve. Correction: Installed a new valve. removed base for access panel and pulled all the old staples. Restapled the base to the panel and installed access panel.				
	Model#	Dlr Sub Hrs	0.50	Sub Labor Amt	\$95.00
	Serial#	Appr Hrs	0.30	Appr Labor Amt	\$57.00

Notes
Please separate into 2 lines because valve will be a vendor issue.TD
OK. Thanks. It won't let me add a new line for the panel yet since this is in feedback. I adjusted the time to .5 for the valve, and I'll do .2 for the panel on a new line once I am able to add it.
NVCB,Per dealers description of this repair. This authorization is pending ALL requirements of repair code have been met.TD

Part

Line# 1	Item #	Description			
	USERPART	55-5289 Fresh water vacuum breaker			
	Model #	Serial #	Part tag	0000403462	
	Sub Qty	1.00	Sub Dlr Price	\$10.64	Sub Freight \$0.00
	Appr Qty	1.00	Appr Dlr Price	\$10.64	Appr Freight \$0.00

Notes

Labor

Line# 10	Operation Code	Operational Description			
	30-100-19-00-001054	Kitchen/Galley Countertop - Interior/Cabinetry/Reseal/No Tread Code			
	Complaint, Cause, Correction				
	Original Note : stephanie@dealer-advisors.com, 2026-01-30 15:28:00 :: Complaint: Cracked caulking around countertop Cause: Caulking is cracked at top edge at kitchen sink Correction: Removed the cracked caulking on the countertop, cleaned and reapply with white silicone				
	Model#	Dlr Sub Hrs	0.30	Sub Labor Amt	\$57.00
	Serial#	Appr Hrs	0.20	Appr Labor Amt	\$38.00

Notes
NVCB, Per dealers description of this repair. This authorization is pending ALL requirements of repair code have been met.TD

Part

Line# 1

Item #		Description			
USERPART		White silicone			
Model #		Serial #		Part tag	
Sub Qty	1.00	Sub Dlr Price	\$1.90	Sub Freight	\$0.00
Appr Qty	1.00	Appr Dlr Price	\$1.90	Appr Freight	\$0.00

Notes

Labor

Line# 11

Operation Code	30-100-24-00-001046	Operational Description	Cabinet Door - Interior/Cabinetry/Repair/No Tread Code		
Complaint, Cause, Correction	Original Note : stephanie@dealer-advisors.com, 2026-01-30 15:30:14 :: Complaint: Medicine cabinet doors are not aligned Cause: Medicine cabinet doors are too close together and are hitting each other Correction: Moved the right cabinet door 1/8 to the right by removing the hinge screws and then reattaching the door ensuring the doors were even. Moved the door catch over on the left an 1/8 of an inch.				
Model#		Dlr Sub Hrs	0.50	Sub Labor Amt	\$95.00
Serial#		Appr Hrs	0.30	Appr Labor Amt	\$57.00

Notes

NVCB, Per dealers description of this repair. This authorization is pending ALL requirements of repair code have been met.TD

Labor

Line# 12

Operation Code	30-100-01-00-001052	Operational Description	Cabinet Door Insert Panel - Interior/Cabinetry/Replace/No Tread Code		
Complaint, Cause, Correction	Original Note : stephanie@dealer-advisors.com, 2026-02-05 17:27:14 :: Complaint: While working on anti-siphon valve we also noted that the access panel under the sink had come apart. Cause: Access panel has come apart. Correction: Removed the base for the access panel, pulled all the old staples, restapled the base on to the panel and installed the access panel.				
Model#		Dlr Sub Hrs	0.20	Sub Labor Amt	\$38.00
Serial#		Appr Hrs	0.20	Appr Labor Amt	\$38.00

Notes

Part

Line# 1

Item #		Description			
USERPART		Staples			
Model #		Serial #		Part tag	
Sub Qty	1.00	Sub Dlr Price	\$1.90	Sub Freight	\$0.00
Appr Qty	1.00	Appr Dlr Price	\$1.90	Appr Freight	\$0.00

Notes

Submitted	Labor Amt	\$1,111.50	Approved	Labor Amt	\$1,016.50
	Parts & Freight	\$88.98		Parts & Freight	\$88.98
	Total	\$1,200.48		Total	\$1,105.48

DEALER

SIGNATURE

DATE

I certify that I have performed these repairs consistent with Forest River Policies.

CUSTOMER

SIGNATURE

DATE

All repairs described have been inspected and are satisfactory.