

FOREST RIVER WARRANTY CLAIM FORM

DEALER ACCOUNT # 0008794 MYERS RV CENTER INC 12024 CENTRAL AVE S.E. ALBUQUERQUE, NM 87123 USA	CLAIM STATUS Authorized CLAIM 2449382 CLAIM ORIGIN WEB ORIGINAL CLAIM ID VIN 4X4TRPU19TB035153 CHASSIS VIN MILEAGE 0 SITE/WAREHOUSE 080 / 080 ITEM # RPT185-80 DEALER RO # 72188 CLAIM START DATE 09/26/2025 CLAIM END DATE 01/01/1900
--	---

Labor rate: \$190.00
 OWNER INFORMATION

Retail Date of Purchase WARRANTY EXPIRATION DATE

Claim Line Details

Labor

Line# 1 **Operation Code** **Operational Description**
 20-66-02-17-000672 Striker Plate or Door Lock - Exterior/Entry Doors/Adjust/Latch
Complaint, Cause, Correction
 Original Note : ryliefayth@gmail.com, 2025-09-26 10:44:09 :: Entry door will not close / Installed incorrectly / Move striker plate a quarter of an inch to allow for proper operation

Model#	Dlr Sub Hrs	0.20	Sub Labor Amt	\$38.00
Serial#	Appr Hrs	0.20	Appr Labor Amt	\$38.00

Notes

Labor

Line# 2 **Operation Code** **Operational Description**
 60-138-24-00-001535 Drainage Lines - Plumbing/Drainage System/Repair/No Tread Code
Complaint, Cause, Correction
 Original Note : ryliefayth@gmail.com, 2025-09-26 10:46:36 :: Water leak at rear of unit in underbelly Incorrect installation Had to gain access to black tank flush. Removed rear portion of underbelly from bumper to rear of axle. Removed sewer, spout, Support, propane, lines, and propane quick disconnect. Removed tank flush from tank cleaned both surfaces attempted to use similar product as manufacturer liquid beaultle Decor brand. Product did not hold flood test. Removed tank flush, clean surface and used ABS glue secured tank flesh and flooded system. No leaks noted.

Model#	Dlr Sub Hrs	8.00	Sub Labor Amt	\$1,520.00
Serial#	Appr Hrs	0.00	Appr Labor Amt	\$0.00

Notes
 hello, can you explain more in depth on why the repair took 8 hours
 We will hold onto this claim for 10 days awaiting a response. Thank you and have a wonderful day.

This claim has now been open for 10 days or more with no response. Due to the age of the claim, this claim has been denied, once all requested information is collected please resubmit the claim for review, Thank you!

Part

Line# 2	Item #	Description			
	USERPART	BUTYL RUBBER SEALANT - 10.1 OZ TUBE (GRAY)			
	Model #	Serial #	Part tag		
	Sub Qty	Sub Dlr Price	Sub Freight	Sub Qty	Sub Price
	1.00	\$5.64	\$0.00	1.00	\$5.64
	Appr Qty	Appr Dlr Price	Appr Freight	Appr Qty	Appr Price
	0.00	\$0.00	\$0.00	0.00	\$0.00

Notes

Labor

Line# 3 **Operation Code** **Operational Description**
60-136-12-00-002120 Water Pump - Plumbing/Fresh Water Supply/Resecure or Tighten/No Tread Code

Complaint, Cause, Correction
Original Note : ryliefayth@gmail.com, 2025-09-26 11:07:21 :: Water pump turns on no pressure Incorrect installation Winterize valave had loose clamps. Installed new clamps and tested. System functioning as designed

Model#	Dlr Sub Hrs	0.50	Sub Labor Amt	\$95.00
Serial#	Appr Hrs	0.30	Appr Labor Amt	\$57.00

Notes
excessive time requested. Time reduced based on photos, description and flat rate.
authorized to install new clamps

Labor Line# 4 **Operation Code** **Operational Description**
60-138-24-00-001526 Termination Valve Cable - Plumbing/Drainage System/Repair/No Tread Code

Complaint, Cause, Correction
Original Note : ryliefayth@gmail.com, 2025-09-26 11:16:17 :: Black tank flush vacuum breaker leaking Loose connection Tightened connections and re tested

Model#	Dlr Sub Hrs	0.50	Sub Labor Amt	\$95.00
Serial#	Appr Hrs	0.50	Appr Labor Amt	\$95.00

Notes

Labor Line# 5 **Operation Code** **Operational Description**
60-136-24-00-001497 Fresh Water Tank - Plumbing/Fresh Water Supply/Repair/No Tread Code

Complaint, Cause, Correction
Original Note : ryliefayth@gmail.com, 2025-09-26 11:22:19 :: Poor water pressure went on city hook up Debris in fresh water system. Pulled all airaitor and removed debris. Flushed system until no debris noted.

Model#	Dlr Sub Hrs	0.30	Sub Labor Amt	\$57.00
Serial#	Appr Hrs	0.30	Appr Labor Amt	\$57.00

Notes

Part Line# 1

Item #	Description				
USERPART	TEFLON THREAD SEAL				
Model #	Serial #		Part tag		
Sub Qty	1.00	Sub Dlr Price	\$0.35	Sub Freight	\$0.00
Appr Qty	0.00	Appr Dlr Price	\$0.00	Appr Freight	\$0.00

Notes

Labor Line# 6 **Operation Code** **Operational Description**
10-9-01-00-000162 Scissor Jack, each - Frame & Chassis/Levelers, Underbelly/Replace/No Tread Code

Complaint, Cause, Correction
Original Note : stephanie@dealer-advisors.com, 2025-12-18 21:33:36 :: Complaint: Door side rear stabilizer jack is bent Cause: Defective jack Correction: Remove and replace jack

Model#	Dlr Sub Hrs	0.50	Sub Labor Amt	\$95.00
Serial#	Appr Hrs	0.50	Appr Labor Amt	\$95.00

Notes

Labor Line# 7 **Operation Code** **Operational Description**
10-3-01-00-000078 Bumper Mount Spare Tire Carrier - Frame & Chassis/Wheels, Tires, Hubcaps/ Replace/No Tread Code

Complaint, Cause, Correction
Original Note : stephanie@dealer-advisors.com, 2025-12-18 21:35:29 :: Complaint: Spare tire carrier u bolt is broken Cause: Overtightened Correction: Replace u bolt

