

FOREST RIVER WARRANTY CLAIM FORM

DEALER ACCOUNT # 0008794 MYERS RV CENTER INC 12024 CENTRAL AVE S.E. ALBUQUERQUE, NM 87123 USA	CLAIM STATUS Authorized CLAIM 2551396 CLAIM ORIGIN WEB ORIGINAL CLAIM ID VIN 4X4TRPU19TB035153 CHASSIS VIN MILEAGE 0 SITE/WAREHOUSE 080 / 080 ITEM # RPT185-80 DEALER RO # 72188 CLAIM START DATE 01/14/2026 CLAIM END DATE 01/01/1900
--	---

Labor rate: \$190.00
 OWNER INFORMATION

Retail Date of Purchase WARRANTY EXPIRATION DATE

Claim Line Details

Labor

Line# 1 **Operation Code** 10-9-15-00-000168 **Operational Description** Polymax Underbelly - Frame & Chassis/Levelers, Underbelly/Repair or Replace/ No Tread Code

Complaint, Cause, Correction
 Original Note : stephanie@dealer-advisors.com, 2026-01-14 16:39:46 :: This job was denied once with notations on claim 2449382 to provide a better story to support the labor. Complaint: Water leak at rear of unit in underbelly. Cause: During inspection water was leaking on ground when conducting the flood test. Checked connections at the shower, sink and faucets. Removed access cover under all fixtures and performed leak test to ensure no pressure side leak present. Noted toilet level dropping. Inspected toilet seal, but no leak noted. Correction: Remove and install underbelly from rear bumper to axle. Had to remove propane quick connect and metal clamps. Removed foam seal and reseal underbelly, 3.4 hours. First attempt at repair using liquid butyl, had to pull unit out of bay to dump water out to allow adhesive to cure. Flood tested for 15 minutes and unit still leaks - 1.8 hours. Second repair attempt using ABS glue, pulled unit out and dumped and allowed tank to dry. Removed tank flush and cleaned both surfaces. Applied ABS glue and secure tank flush to base. Let cure and flood tested to ensure repair. Unit passed leak test - 3.2 hours.

Model#	Dlr Sub Hrs 8.40	Sub Labor Amt \$1,596.00
Serial#	Appr Hrs 6.60	Appr Labor Amt \$1,254.00

Notes
 We can offer 6.6 for the first repair and last. The second repair that didn't work we would not be able to offer anytime as the fix didn't correct it.

Labor

Line# 2 **Operation Code** 10-3-01-00-000078 **Operational Description** Bumper Mount Spare Tire Carrier - Frame & Chassis/Wheels, Tires, Hubcaps/ Replace/No Tread Code

Complaint, Cause, Correction
 Original Note : stephanie@dealer-advisors.com, 2026-01-14 16:42:07 :: Complaint: Spare tire holder is loose Cause: U bolt broken from being overtightened and misaligned Correction: Remove and replace spare tire holder

Model#	Dlr Sub Hrs 0.30	Sub Labor Amt \$57.00
Serial#	Appr Hrs 0.30	Appr Labor Amt \$57.00

Notes

Submitted	Labor Amt	\$1,653.00	Approved	Labor Amt	\$1,311.00
	Parts & Freight	\$0.00		Parts & Freight	\$0.00
	Total	\$1,653.00		Total	\$1,311.00

DEALER _____	CUSTOMER _____
DATE _____	DATE _____

SIGNATURE

I certify that I have performed these repairs consistent with Forest River Policies.

SIGNATURE

All repairs described have been inspected and are satisfactory.