



12024 Central Ave SE ★ Albuquerque NM 87123
 www.MYERSRV.com
 (505)298-7691 ★ 1-800-748-2078 ★ FAX (505)293-7172

W/O: 72768
 Promised Date:
 02 JAN 26



WO #: 72768

Customer Name: 1000 - MYERS "RV"
 CENTER, INC.

Completed Date:
 Invoice#:
 Author: ADVISOR
 Stock Desc: 9652 2026 AVENGER 27REI
 Serial#: 941670
 Chassis#: 5ZT2AVSB2TB941670
 Miles/Hrs:
 Tag#: IN DETAIL'S BAY
 Purchased Date:
 Warranty Date:

Date In: 02 JAN 26
 Time In:

Job #PDI1 - Internal

COMPLAINT: PRE-PDI NEW TT - 3.0

CAUSE: Initial inspection

CORRECTION: Performed inspection and supplied list of concerns.

Labor

Job #	Description	Total
PDI1	PDI TRAVEL TRAILER	N/C

Parts

Part #	Description	Qty	Price	Total
1000	L.P. GAS	10.00	N/C	N/C
17150	SPRAY FOAM, KRAKEN BOND (BLACK)	1.00	N/C	N/C

Other Services

Code	Description	Qty	Price	Total
SS	SHOP SUPPLIES	0.00	N/C	N/C

Subtotal for Job #PDI1: 0.00

Job #WIN-STD - Internal

COMPLAINT: WINTERIZE STANDARD

CAUSE: Stock inspection

CORRECTION: Winterize completed

Labor

Job #	Description	Total
WIN-STD	WINTERIZE RV - BASIC	N/C

Parts

Part #	Description	Qty	Price	Total
21622	ANTIFREEZE	3.00	N/C	N/C

Other Services

Code	Description	Qty	Price	Total
SS	SHOP SUPPLIES	0.00	N/C	N/C

Subtotal for Job #WIN-STD: 0.00

Customer #: 1000
 MYERS "RV" CENTER,
 INC.,





Job #01 - Warranty

COMPLAINT: Entertainment Center, Hideaway door pulled from door jam

CAUSE: Incorrect installation

CORRECTION: Had to call Foreman to verify repair. Foreman suggest calling Forest River for approval or suggestions on repair due to door weight. Call Forest River and left Darren a message. Left last eight of the Vin and floor plan with description of issue awaiting response. January 12 11:04 AM.

Labor

Job #	Description	Total
01	MISC LABOUR CODE (WARRANTY)	N/C

Parts

Part #	Description	Qty	Price	Total
7725	LIQUID NAILS	1.00	N/C	N/C

Subtotal for Job #01: 0.00

Job #02 - Warranty

COMPLAINT: Bedroom pocket door pulled from ceiling

CAUSE: Incorrect installation

CORRECTION: attempted to secure pocket door track with wider fasteners. After installation of track and indoor bracket pulled from wall with one use. Correct repair would require removing ceiling panel and install installing lumber backer to anchor heavy pocket door. Removal of ceiling panel would require removal of air-conditioning Plenum television, antenna plate, TV outlet closet door, inner closet, trim, closet, door, jamb pocket door, valance air-conditioning register and reinstallation of Backer. Requesting 16.8 hours for repair.

Labor

Job #	Description	Total
02	MISC LABOUR CODE (WARRANTY)	N/C

Subtotal for Job #02: 0.00

Job #03 - Warranty

COMPLAINT: Send tape at kitchen wall peeling at two separate areas

CAUSE: Incorrect installation

CORRECTION: Removed damaged seamtape. Debris on adhesive. Cleaned surface and installed new seamtape

Labor

Job #	Description	Total
03	MISC LABOUR CODE (WARRANTY)	N/C

Subtotal for Job #03: 0.00

Job #04 - Warranty

COMPLAINT: Center Batin strip wallpapers peeling in dinette slide room

CAUSE: Adhesive failed

CORRECTION: Removed trim. During removal trim broke. Installed new batten strip . Had to clean surface and fill voids

Labor

Job #	Description	Total
04	MISC LABOUR CODE (WARRANTY)	N/C





Subtotal for Job #04: 0.00

Job #05 - Warranty

COMPLAINT: Wallpaper cut crooked at forward dinette slide wall

CAUSE: Incorrect installation

CORRECTION: Cleaned surface and applied bead of almond silicone.

Labor

Job #	Description	Total
05	MISC LABOUR CODE (WARRANTY)	N/C

Parts

Part #	Description	Qty	Price	Total
8867	ALMOND SILICONE	1.00	N/C	N/C

Subtotal for Job #05: 0.00

Job #06 - Warranty

COMPLAINT: Excessive wood putty, and construction stain on walls, ceilings, and cabinet doors

CAUSE: Incorrect installation

CORRECTION: Cleaned surfaces of marks and excessive putty. Filled voids and gaps.

Labor

Job #	Description	Total
06	MISC LABOUR CODE (WARRANTY)	N/C

Subtotal for Job #06: 0.00

Job #07 - Warranty

COMPLAINT: Missing red battery disconnect plug

CORRECTION: Need to order battery disconnect

Labor

Job #	Description	Total
07	MISC LABOUR CODE (WARRANTY)	N/C

Subtotal for Job #07: 0.00

Job #08 - Warranty

COMPLAINT: WARRANTY ITEM

Labor

Job #	Description	Total
08	Voids and gaps in underbelly	N/C

Subtotal for Job #08: 0.00

Job #09 - Warranty

COMPLAINT: WARRANTY ITEM

CAUSE: Incorrect installation

CORRECTION: Had to pull underbelly to gain access to water leak. Found cold water connection leaking at crimp. Removed clamp cut hose square and reinstalled crimp clamp. Pressure tested , no leaks noted

Labor

Job #	Description	Total
09	Water leak at underbelly in front of front axle	N/C



Subtotal for Job #09: 0.00

Job #10 - Warranty
COMPLAINT: WARRANTY ITEM

CAUSE: Component failure

CORRECTION: Verify water pressure going into black tank flush inlet. Removed antisiphon valve from under bathroom sink. Verified orientation. Removed and checked for obstructions. During removal check valve came apart. Need to replace antisiphon valve and retest black tank flush to ensure operation.

Labor

Job #	Description	Total
10	Black tank flush dose not work	N/C

Subtotal for Job #10: 0.00

Parts Total: 0.00
 Labour Total: 0.00
 Sublet Total: 0.00
 Extras Total: 0.00

WORK ORDER TOTAL: 0.00

NOTICE:
DUE TO A LACK OF SPACE, A \$15/DAY STORAGE FEE WILL APPLY IF YOU DO NOT PICK UP YOUR UNIT WITHIN 48 HOURS OF NOTICE OF COMPLETION

EFFECTIVE 01/12/2026 A CREDIT CARD SURCHARGE OF 3% WILL BE APPLIED TO ALL CREDIT CARD TRANSACTIONS

MANUFACTURER'S WARRANTIES AND SERVICE CONTRACTS DO NOT COVER DIAGNOSTIC TIME IF NO PROBLEM IS FOUND

ALTHOUGH WE TAKE PRECAUTIONS TO INSURE YOUR VEHICLE'S SECURITY WHILE IN FOR REPAIRS, WE ARE NOT RESPONSIBLE FOR ANY LOSS OR DAMAGE TO THE VEHICLE OR CONTENTS DUE TO FIRE, THEFT, OR ANY OTHER CAUSE BEYOND OUR CONTROL. WE WOULD APPRECIATE YOUR ASSISTANCE BY REMOVING OR SECURING YOUR VALUABLES SUCH AS GUNS, CAMERAS, JEWELRY, CASH, ETC.

I hereby authorize Myers RV Center, Inc. to perform the repair work set forth in this work order, including the parts and materials necessary. I agree that you are not responsible for delays caused by unavailability of parts or delays in parts shipments by the supplier or transporter. I hereby grant you and/or your employees permission to operate the vehicle herein described on streets and highways for the purpose of testing, inspection or transporting to sublet vendors. An express mechanics lien is hereby acknowledged on the herein described vehicle to secure the payment for repairs performed.

Date: 22 Jan 2026

Customer Signature : _____

W/O: 72768
Promised Date: 09 JAN 26



Customer #: 1000
MYERS "RV" CENTER,
INC.,

