



Phone: (423) 235-1167  
Toll Free: (877) 635-1167  
Fax: (423) 235-1176

1202 Idell Road  
Bulls Gap, TN 37711

W/O: 25389



WO #: 25389 (Appointment Date: 05 MAY 2025 - Time: 09:00am)

Customer: 92565 - CAMPBELL, BRET  
Address: 156 LINK RD  
COTTONTOWN, TN  
37048

Home Phone: (615) 983-9354

Work Phone:

Author:SPD

Location: IH

Invoice #:

Stock #: 10992

Stock Desc: 2025 TT FOREST RIVER

ROCKWOOD MINI 2513S

Model: 2513S

Serial #: 4X4TRLB2XSD461344

Chassis #:

Mileage:

Key #: 4500

Req'n #:

License #:

Trim:

Purchase Date: 07 MAR 25

Date In: 03 MAY 25

Promise Date:

Promise Time:

Schedule Date:

Completed: 13 JUN 25

Warr. Date: 07 MAR 25

### Job #1 - External

DROPPING OFF SATUDRAY MAY 3RD

#### Other Services

| Code | Description            | Qty  | Price | Total |
|------|------------------------|------|-------|-------|
| SSE  | SHOP SUPPLIES EXTERNAL | 1.00 | N/C   | N/C   |

**Subtotal for Job #1: 0.00**

### Job #2 - Warranty

COMPLAINT: CS AFTER THE LAST STORM CUSTOMER NOTICED WATER LEAKING IN FROM  
UNDER THE MAIN LIVING SLIDE  
UNIT HAS CABINET DAMAGE FROM THE WATER LEAK.

CAUSE: WATER TEST DONE ON SLIDE WITH SLIDE IN AND OUT, NO LEAK FOUND FROM  
SLIDE.LEAK FROM D-SEAL ON COMPARTMENT DOOR(LINE 7). WATER DID ENTER UNIT UNDER  
SLIDE AND DAMAGED CABINETS IN KITCHEN.

CORRECTION: LEAK WILL BE ADDRESSED ON LINE 7. SEVERAL DAMAGED STILE/CABINETS,  
COMPLETE BOTTOM. REMOVE AND REPLACE ALL BOTTOM STILE OF KITCHEN SINK CABINET  
AREA.

LABOR 6.0

#### Labor

| Job # | Description                | Hours | Total  |
|-------|----------------------------|-------|--------|
| 2     | REPAIRED THE DAMAGED STILE | 4.00  | 660.00 |

#### Parts

| Part #     | Description                                          | Qty  | Price | Total |
|------------|------------------------------------------------------|------|-------|-------|
| F100347106 | STILE - PFL: SQUARE EDGE -<br>SEDONAWOOD - 4" X 8'   | 2.00 | 14.29 | 28.58 |
| F100347105 | STILE - PFL: SQUARE EDGE -<br>SEDONAWOOD - 3" X 8' - | 2.00 | 10.75 | 21.50 |
| F100347044 | STILE - PFL: SQUARE EDGE -<br>SEDONAWOOD - 2" X 8'   | 2.00 | 7.59  | 15.18 |
| F100347108 | STILE - PFL: SQUARE EDGE -<br>SEDONAWOOD - 3/4" X 8' | 2.00 | 4.02  | 8.04  |

#### Other Services

| Code | Description          | Qty  | Price  | Total  |
|------|----------------------|------|--------|--------|
| SHP  | SHIPPING/FREIGHT FEE | 1.00 | 5.00   | 5.00   |
| SHP  | SHIPPING/FREIGHT FEE | 1.00 | 129.66 | 129.66 |
| NII  | F100270074           | 1.00 | 13.00  | 13.00  |

Customer #: 92565  
CAMPBELL, BRET



Subtotal for Job #2: 880.96

### Job #3 - Warranty

COMPLAINT: CS THAT THE SOLAR IS NOT WORKING CHECK AND ADVISE

CAUSE: SOLAR CONTROLLER NOT READING ANY CHARGE. CONTROL HAS 22. VDC FROM SOLAR. NO VOLTAGE READING ON BATTERY LEGGS. TRACED WIRE FROM BATTERY TO 30 A BREAKER 0 VDC FROM SOLAR CONTROL TO BREAKER.

CORRECTION: REPLACE THE BREAKER AND TEST.  
LABOR .50

#### Labor

| Job # | Description      | Hours | Total |
|-------|------------------|-------|-------|
| 3     | REPLACED BREAKER | 0.50  | 82.50 |

#### Parts

| Part #     | Description                                                         | Qty  | Price | Total |
|------------|---------------------------------------------------------------------|------|-------|-------|
| F100239360 | BREAKER - PFL: AUTO RESET TYPE 1<br>MINI BREAKER, SHORTSTOP, 30 AMP | 1.00 | 2.20  | 2.20  |

Subtotal for Job #3: 84.70

### Job #4 - Warranty

COMPLAINT: DRAWER ON LEFT AT BOTTOM AS YOU ENTER UNIT IS NOT WORKING CORRECTLY

CAUSE: DRAWER GUIDE IS OFF BY 1/4" NOT ALLOWING DRAWER TO WORK CORRECT.

CORRECTION: REMOVE DRAWER AND GUIDES, ADD SHIM TO ALLOW THE DRAWER TO FIT CORRECTLY. REINSTALL GUIDE AND DRAWER.  
LABOR .50

#### Labor

| Job # | Description           | Hours | Total |
|-------|-----------------------|-------|-------|
| 4     | REPAIRED DRAWER GUIDE | 0.30  | 49.50 |

Subtotal for Job #4: 49.50

### Job #5 - Warranty

COMPLAINT: IF LOOKING AT KITCHEN SINK ON BOTTOM LEFT IS NOT WORKING CORRECTLY SEEMS THEY ARE NOT SPACED CORRECTLY

CAUSE: DRAWER IS ALSO OFF 1/4" NOT ALLOWING DRAWER TO WORK CORRECTLY.

CORRECTION: REMOVE DRAWER AND GUIDES, ADD SHIM, REINSTALL GUIDE AND DRAWER.  
LABOR .50

#### Labor

| Job # | Description         | Hours | Total |
|-------|---------------------|-------|-------|
| 5     | REPAIR DRAWER GUIDE | 0.30  | 49.50 |

Subtotal for Job #5: 49.50

### Job #6 - Warranty

COMPARTMENT DOOR ON NDS BELOW MAIN SLIDE LOCK WILL NOT WORK  
CUST HAD ISSUES AT THE TIME OF PICK UP WHEN PURCHASED

#### Parts

| Part #     | Description                                                                                        | Qty  | Price | Total |
|------------|----------------------------------------------------------------------------------------------------|------|-------|-------|
| F100552780 | COMPARTMENT DOOR PART- SOP:<br>HOLLOW D-SEAL, W/ TAPE, FOR MINI<br>SLAM LATCH COMPARTMENT<br>DOORS | 5.00 | 1.17  | 5.85  |

W/O: 25389



Customer #: 92565  
CAMPBELL, BRET



Subtotal for Job #6: 5.85

W/O: 25389

Job #7 - Warranty

COMPLAINT: DS COMPARTMENT DOOR HAS HAD WATER STANDING IN IT DIFF TIMES  
DOOR SEEMS TO STICK OUT MORE AT THE TOP THEN THE BOTTOM

CAUSE: WATER LEAKING THROUGH GAP IN D-SEAL NEAR LATCH.D-SEAL HAS A GAP AND  
ALLOWING WATER TO ENTER THE COMPARTMENT AREA. WATER IS ALSO RUNNING INTO  
KITCHEN AREA UNDER SLIDE. (LINE 2)

CORRECTION: REMOVE AND REPLACE D-SEAL ON COMPARTMENT DOOR.  
LABOR 1.0

Labor

| Job # | Description        | Hours | Total |
|-------|--------------------|-------|-------|
| 7     | REPLACE THE D SEAL | 0.50  | 82.50 |

Subtotal for Job #7: 82.50

|               |        |
|---------------|--------|
| Parts Total:  | 81.35  |
| Labour Total: | 924.00 |
| Sublet Total: | 0.00   |
| Extras Total: | 147.66 |

WORK ORDER TOTAL: 1,153.01

I HEREBY ACCEPT ABOVE DESCRIBED WORK AS SATISFACTORY & COMPLETE TO MY SATISFACTION.

X

MOTOR VEHICLE REPAIR REGISTRATION #MV-04967

Customer Signature : \_\_\_\_\_

Date: 13 Jun 2025

Customer #: 92565  
CAMPBELL, BRET