



Phone: (423) 235-1167  
Toll Free: (877) 635-1167  
Fax: (423) 235-1176

1202 Idell Road  
Bulls Gap, TN 37711

W/O: 25508



WO #: 25508 (Appointment Date: 27 MAY 2025 - Time: 09:00am)

Customer: 59072 - EXTREME AUTOMOTIVE,  
KYKERS  
Address: 1201 TUSCULUM BLVD  
GREENEVILLE, TN  
37745

Home Phone: 423-525-5147

Work Phone:

Author:CLP

Location: IH

Invoice #:

Stock #: 10911

Stock Desc: 2024 FW FOREST RIVER CEDAR

CREEK 391WOW

Model: 391WOW

Serial #: 4X4FCRR27RS233105

Chassis #:

Mileage:

Key #: 13200

Req'n #:

License #:

Trim:

Purchase Date: 28 DEC 24

Date In: 27 MAY 25

Promise Date:

Promise Time:

Schedule Date:

Completed:

Warr. Date: 28 DEC 24

**Job #1 - Warranty**

COMPLAINT: AC IS BUZZING AFTER RUNS A WHILE FRONT AND REAR. THIS JOB IS FOR THE BEDROOM A/C. THIS IS AFTER FREEZE SENSORS WERE INSTALLED.

CAUSE: INSULATION FLAPPING ON A/C AND ONLY HAD ONE MOUNTING SCREW HOLDING A/C CONTROL BOARD.

CORRECTION: RESECURED INSULATION IN PLACE AND ADDED TWO MOUNTING SCREWS.  
LABOR .30

**Subtotal for Job #1: 0.00**

**Job #2 - Warranty**

COMPLAINT: CABINET DOOR IS NOT CLOSING AND IS SPLIT

CAUSE: DOOR IS SPLIT AND BOWED TO WHERE IT WILL NOT CLOSE AS DESIGNED.

CORRECTION: REPLACE DOOR AND THIS WILL NEED TO BE PRECUT FOR HARDWARE.  
LABOR .30

**Subtotal for Job #2: 0.00**

**Job #3 - Warranty**

COMPLAINT: CLOSET DOOR IS DRAGGING

CAUSE: CLOSET DOOR HANGERS RUBBING ON CEILING MOUNTED TRACK. TECH ATTEMPTED TO ADJUST AND NO CHANGE IN CONCERN.

CORRECTION: REPLACE TRACK,HANGERS AND ROLLERS.  
LABOR .30

**Subtotal for Job #3: 0.00**

**Job #4 - Warranty**

OFF DOOR SIDE REAR WHEEL IS HOT AFTER 1 HOUR DRIVE DOOR SIDE REAR IS COLD CHECK AND ADVISE

Customer #: 59072  
EXTREME AUTOMOTIVE,  
KYKERS



Subtotal for Job #4: 0.00

**Job #5 - Warranty**

COMPLAINT: TRIM COMING LOOSE ACROSS FROM ENTRANCE DOOR

CAUSE: TRIM CAME LOOSE AND NOT IN PLACE CORRECT.

CORRECTION: RESECURE TRIM IN PLACE  
LABOR .10

Subtotal for Job #5: 0.00

**Job #6 - Warranty**

COMPLAINT: TRIM LOOSE ON RIGHT FACIA BED SLIDE

CAUSE: TRIM WORKED LOOSE AND NOT IN PLACE.

CORRECTION: RESECURE TRIM TO FASCIA  
LABOR .10

Subtotal for Job #6: 0.00

**Job #7 - Warranty**

COMPLAINT: TRIM MISSING ON BATH DOOR ENTRANCE, BOTTOM RIGHT

CAUSE: TRIM IS MISSING 1" BATTON STRIP AT THE BATHROOM DOOR ENTRANCE.

CORRECTION: INSTALL 1" BATTON STRIP  
LABOR 1.0

Subtotal for Job #7: 0.00

**Job #8 - Warranty**

COMPLAINT: LP WIRES HANGING BELOW THE ALARM IN REAR OF UNIT

CAUSE: WIRING WAS NOT SECURE IN PLACE AND CAME LOOSE.

CORRECTION: RESECURED WIRING IN CORRECT PLACE.  
LABOR .30

Subtotal for Job #8: 0.00

**Job #9 - Warranty**

COMPLAINT: DOOR SIDE COMPARTMENT SLAM LOCK CYLINDER IS MISSING ITS FACE

CAUSE: SLAM LOCK CYLINDER FACE MISSING

CORRECTION: REPLACE TUMBLER ON COMPARTMENT DOOR  
LABOR .20

Subtotal for Job #9: 0.00

**Job #10 - Warranty**

COMPLAINT: FRONT AND REAR AC COMPRESSOR KICKS ON FOR ABOUT 30 SECS AND SHUTS OFF

CAUSE: TECH WENT ON SC AND FOUND THAT NEITHER AC HAD A FREEZE SENSOR INSTALLED

CORRECTION: TECH INSTALLED FREEZE SENSORS ON BOTH A/C'S THAT WE HAD IN STOCK TO ALLOW CUST TO GO ON TRIP.  
LABOR 1.0 (LABOR FOR 2 A/C'S)



Customer #: 59072  
EXTREME AUTOMOTIVE,  
KYKERS



Subtotal for Job #10: 0.00

**Job #11 - Warranty**

COMPLAINT: AC IS BUZZING AFTER RUNS A WHILE, THIS IS FOR THE LIVING ROOM A/C. THIS WAS AFTER THE FREEZE SENSOR WAS INSTALLED.

CAUSE: INSULATION FLAPPING AND ONLY HAD ONE MOUNTING SCREW HOLDING A/C CONTROL BOARD.

CORRECTION: RESECURED INSULATION IN PLACE AND ADDED TWO MOUNTING SCREWS.  
LABOR .30

Subtotal for Job #11: 0.00

**Job #12 - Warranty**

COMPLAINT: WALL TRIM LOOSE BELOW SHELF ACROSS FROM ENTRY DOOR

CAUSE: TRIM CAME LOOSE

CORRECTION: RESECURE TRIM IN CORRECT PLACE.  
LABOR .10

Subtotal for Job #12: 0.00

**Job #13 - Warranty**

COMPLAINT: PANTRY DOOR IS SPLITTING AND BOWED.

CAUSE: PANTRY DOOR IS SPLIT AND WOOD IS BOWING OUT.

CORRECTION: REPLACE THE PANTRY DOOR  
LABOR .30

Subtotal for Job #13: 0.00

Parts Total:	0.00
Labour Total:	0.00
Sublet Total:	0.00
Extras Total:	0.00
<b>WORK ORDER TOTAL:</b>	<b>0.00</b>

-----  
I HEREBY ACCEPT ABOVE DESCRIBED WORK AS SATISFACTORY & COMPLETE TO MY SATISFACTION.

X \_\_\_\_\_

-----  
MOTOR VEHICLE REPAIR REGISTRATION #MV-04967

Date: 02 Jun 2025

Customer Signature : \_\_\_\_\_

W/O: 25508



Customer #: 59072  
EXTREME AUTOMOTIVE,  
KYKERS

