



Phone: (423) 235-1167
Toll Free: (877) 635-1167
Fax: (423) 235-1176

1202 Idell Road
Bulls Gap, TN 37711

W/O: 25820



WO #: 25820 (Appointment Date: 28 JUL 2025 - Time: 09:00am)

Customer: 93064 - BLAZER, CARROLL
Address: 1350 TIN OAK DRIVE

37814
Home Phone: 423-736-7740
Work Phone:
Author: S.DAVIS
Location: IH
Invoice #:

Stock #:
Stock Desc: 2023 KEYSTONE SUNSET TRAIL
269FK
Model: 269FK
Serial #: 4YDTSSM2XP5350356
Chassis #:
Mileage:
Key #:
Req'n #:
License #:
Trim:

Purchase Date:
Date In: 23 JUL 25
Promise Date:
Promise Time:
Schedule Date:
Completed: 10 OCT 25
Warr. Date:

Job #1 - Warranty

COMPLAINT: CABLE ON THE LIVING ROOM SLIDE OUT IS FRAYED

CAUSE: LOWER RIGHT RETRACT CABLE IS FREYED AND THINNING. TECH DID INSPECT ALL OTHER CABLES AND NO ISSUES AT THIS TIME OTHER THAN THE ONE.

CORRECTION: REMOVE FAULTY CABLE AND REPLACE WITH NEW CABLE.
LABOR 2.0 TO REPLACE AND .50 TO ADJUST SLIDE IN CORRECT POSITION.
TOTAL LABOR 2.5

Labor

Job #	Description	Hours	Total
1	REPLACED CABLE	2.50	437.50
Subtotal for Job #1:			437.50

Job #2 - Warranty

COMPLAINT: LEAK UNDER THE KITCHEN SINK FROM ONE OF THE LINES

CAUSE: TECH INSPECTED AREA AND FOUND WATER LEAKING FROM THE COLD SIDE OF FAUCET CONNECTION. CONNECTION WASN'T FULLY SEATED IN CORRECT POSTION.

CORRECTION: ALL WATER FITTING WERE TIGHTENED, RETESTED AFTERWARDS AND NO LEAKS AT THIS TIME.
LABOR .30

Labor

Job #	Description	Hours	Total
2	TIGHTENED WATER FITTING	0.20	35.00

Other Services

Code	Description	Qty	Price	Total
SSE	SHOP SUPPLIES EXTERNAL	1.00	17.50	17.50
Subtotal for Job #2:				52.50

Job #3 - Warranty

COMPLAINT: LIGHT SWITCH NOT INSTALLED CORRECTLY
SWITCH IS STICKING OUT FROM THE WALL

CAUSE: TECH CAN'T GET SWITCH TO SEAT PROPERLY INTO HOLDER. AFTER REMOVING THE SWITCH TO INSPECT, FOUND THE SWITCH WAS INSTALLED UP AGAINST THE SEWER VENT PIPE.

Customer #: 93064
BLAZER, CARROLL



CORRECTION: SWITCH NEEDS TO BE MOVED ABOUT 1" TO THE RIGHT TO CORRECT ISSUE. WE WILL NEED TO REPLACE THE WALL LUAN AS WELL TO CORRECT THE HOLE THAT WILL BE THERE FROM RELOCATING THE SWITCH.

LABOR 2.5

Labor

Job #	Description	Hours	Total
3	REPAIRED AREA WHERE SWITCH WAS	0.20	35.00

Parts

Part #	Description	Qty	Price	Total
659081	WALL LUAN	1.00	73.31	73.31

Other Services

Code	Description	Qty	Price	Total
SHP	SHIPPING/FREIGHT FEE	1.00	50.00	50.00

Subtotal for Job #3: 158.31

Job #4 - Warranty

COMPLAINT: UPPER RIGHT FASCIA HAS A CRACK IN IT

CAUSE: DEFECT IN THE FASCIA BOARD ALLOWING IT TO CRACK. AREA CAN'T BE FILLED, COLORED AND BLENDED.

CORRECTION: REMOVED DAMAGED FASCIA AND REPLACE WITH NEW.

LABOR .50

Labor

Job #	Description	Hours	Total
4	REPLACED	0.30	52.50

Parts

Part #	Description	Qty	Price	Total
664644	HEADER INSERT	1.00	30.24	30.24

Other Services

Code	Description	Qty	Price	Total
CRA	CRATE CHARGES	1.00	50.00	50.00
SHP	SHIPPING/FREIGHT FEE	1.00	195.57	195.57
SHP	SHIPPING/FREIGHT FEE	1.00	40.65	40.65
CRA	CRATE ON 664644	1.00	50.00	50.00
SHP	SHP ON 664644	1.00	215.13	215.13

Subtotal for Job #4: 634.09

Job #5 - Warranty

COMPLAINT: FALSE WALL IS PRESSING AGAINST SINK DRAIN CAUSING ISSUES CHECK AND ADVISE

CAUSE: PANEL FROM INSTALL WILL NOT SIT UP STRAIGHT. PANEL IS HITTING THE DRAIN PIPE.

CORRECTION: REPLACE PANEL AND CUT TO FIT PROPERLY.

LABOR .30

Labor

Job #	Description	Hours	Total
5	REPAIRED	0.20	35.00

Parts

Part #	Description	Qty	Price	Total
693822	FALSE PANEL	1.00	49.60	49.60

Subtotal for Job #5: 84.60

Job #6 - Warranty

COMPLAINT: ON LINE 4 WE WERE APPROVED TO REPLACE THE FASCIA THAT IS CRACKED. WE

Customer #: 93064
BLAZER, CARROLL

ARE NOT ABLE TO GET THE SAME FASCIA IN FOR THE CUST,TWO ATTEMPTS HAVE BEEN MADE.
WE ARE ASKING TO REPLACE ALL FASCIA SO IT WILL MATCH.

CAUSE: REPLACE ALL SLIDE FASCIA SO IT WILL MATCH DUE TO NOT BEING ABLE TO GET THE
CORRECT COLOR AND SIZE FROM KEYSTONE

CORRECTION: REMOVE ALL FASCIA AND REPALCE WITH NEW FASCIA
LABOR 2.0

Labor

Job #	Description	Hours	Total
6	REPLACED STILE	2.00	350.00

Parts

Part #	Description	Qty	Price	Total
664644	HEADER INSERT	1.00	30.24	30.24
664647	LEG ASSEMBLY CANNON GREY CHERRY	1.00	16.16	16.16

Subtotal for Job #6: 396.40

Parts Total: 199.55
Labour Total: 945.00
Sublet Total: 0.00
Extras Total: 618.85
WORK ORDER TOTAL: 1,763.40

I HEREBY ACCEPT ABOVE DESCRIBED WORK AS SATISFACTORY & COMPLETE TO MY SATISFACTION.
X

MOTOR VEHICLE REPAIR REGISTRATION #MV-04967

Customer Signature : _____

Date: 10 Oct 2025

W/O: 25820



Customer #: 93064
BLAZER, CARROLL

