



Phone: (423) 235-1167  
 Toll Free: (877) 635-1167  
 Fax: (423) 235-1176

1202 Idell Road  
 Bulls Gap, TN 37711

W/O: 25820



WO #: 25820 (Appointment Date: 28 JUL 2025 - Time: 09:00am)

Customer: 93064 - BLAZER, CARROLL  
 Address: 1350 TIN OAK DRIVE

37814  
 Home Phone: 423-736-7740

Work Phone:  
 Author: S.DAVIS  
 Location: IH  
 Invoice #:

Stock #:  
 Stock Desc: 2023 KEYSTONE SUNSET TRAIL  
 269FK  
 Model: 269FK  
 Serial #: 4YDTSSM2XP5350356  
 Chassis #:  
 Mileage:  
 Key #:  
 Req'n #:  
 License #:  
 Trim:

Purchase Date:  
 Date In: 23 JUL 25  
 Promise Date:  
 Promise Time:  
 Schedule Date:  
 Completed:  
 Warr. Date:

**Job #1 - Warranty**

COMPLAINT: CABLE ON THE LIVING ROOM SLIDE OUT IS FRAYED

CAUSE: LOWER RIGHT RETRACT CABLE IS FREYED AND THINNING. TECH DID INSPECT ALL OTHER CABLES AND NO ISSUES AT THIS TIME OTHER THAN THE ONE.

CORRECTION: REMOVE FAULTY CABLE AND REPLACE WITH NEW CABLE.  
 LABOR 2.0 TO REPLACE AND .50 TO ADJUST SLIDE IN CORRECT POSITION.  
 TOTAL LABOR 2.5

**Subtotal for Job #1: 0.00**

**Job #2 - Warranty**

COMPLAINT: LEAK UNDER THE KITCHEN SINK FROM ONE OF THE LINES

CAUSE: TECH INSPECTED AREA AND FOUND WATER LEAKING FROM THE COLD SIDE OF FAUCET CONNECTION. CONNECTION WASN'T FULLY SEATED IN CORRECT POSTION.

CORRECTION: ALL WATER FITTING WERE TIGHTENED, RETESTED AFTERWARDS AND NO LEAKS AT THIS TIME.  
 LABOR .30

**Other Services**

Code	Description	Qty	Price	Total
SSE	SHOP SUPPLIES EXTERNAL	1.00	N/C	N/C

**Subtotal for Job #2: 0.00**

**Job #3 - Warranty**

COMPLAINT: LIGHT SWITCH NOT INSTALLED CORRECTLY  
 SWITCH IS STICKING OUT FROM THE WALL

CAUSE: TECH CAN'T GET SWITCH TO SEAT PROPERLY INTO HOLDER. AFTER REMOVING THE SWITCH TO INSPECT, FOUND THE SWITCH WAS INSTALLED UP AGAINST THE SEWER VENT PIPE.

CORRECTION: SWITCH NEEDS TO BE MOVED ABOUT 1" TO THE RIGHT TO CORRECT ISSUE. WE WILL NEED TO REPLACE THE WALL LUAN AS WELL TO CORRECT THE HOLE THAT WILL BE THERE FROM RELOCATING THE SWITCH.  
 LABOR 2.5

Customer #: 93064  
 BLAZER, CARROLL



**Parts**

Part #	Description	Qty	Price	Total
659081	WALL LUAN	1.00	N/C	N/C

**Other Services**

Code	Description	Qty	Price	Total
SHP	SHIPPING/FREIGHT FEE	1.00	N/C	N/C

**Subtotal for Job #3: 0.00**

**Job #4 - Warranty**

COMPLAINT: UPPER RIGHT FASCIA HAS A CRACK IN IT

CAUSE: DEFECT IN THE FASCIA BOARD ALLOWING IT TO CRACK. AREA CAN'T BE FILLED, COLORED AND BLENDED.

CORRECTION: REMOVED DAMAGED FASCIA AND REPLACE WITH NEW. LABOR .50

**Parts**

Part #	Description	Qty	Price	Total
664644	HEADER INSERT	1.00	N/C	N/C

**Other Services**

Code	Description	Qty	Price	Total
CRA	CRATE CHARGES	1.00	N/C	N/C
SHP	SHIPPING/FREIGHT FEE	1.00	N/C	N/C

**Subtotal for Job #4: 0.00**

**Job #5 - Warranty**

COMPLAINT: FALSE WALL IS PRESSING AGAINST SINK DRAIN CAUSING ISSUES CHECK AND ADVISE

CAUSE: PANEL FROM INSTALL WILL NOT SIT UP STRAIGHT. PANEL IS HITTING THE DRAIN PIPE.

CORRECTION: REPLACE PANEL AND CUT TO FIT PROPERLY. LABOR .30

**Parts**

Part #	Description	Qty	Price	Total
693822	FALSE PANEL	1.00	N/C	N/C

**Subtotal for Job #5: 0.00**

**Job #6 - Warranty**

COMPLAINT: ON LINE 4 WE WERE APPROVED TO REPLACE THE FASCIA THAT IS CRACKED. WE ARE NOT ABLE TO GET THE SAME FASCIA IN FOR THE CUST, TWO ATTEMPTS HAVE BEEN MADE. WE ARE ASKING TO REPLACE ALL FASCIA SO IT WILL MATCH.

CAUSE: REPLACE ALL SLIDE FASCIA SO IT WILL MATCH DUE TO NOT BEING ABLE TO GET THE CORRECT COLOR AND SIZE FROM KEYSTONE

CORRECTION: REMOVE ALL FASCIA AND REPALCE WITH NEW FASCIA LABOR 2.0

**Subtotal for Job #6: 0.00**



Customer #: 93064  
BLAZER, CARROLL



Parts Total: 0.00  
Labour Total: 0.00  
Sublet Total: 0.00  
Extras Total: 0.00  
**WORK ORDER TOTAL: 0.00**

W/O: 25820

-----  
I HEREBY ACCEPT ABOVE DESCRIBED WORK AS SATISFACTORY & COMPLETE TO MY SATISFACTION.  
-----

X

-----  
MOTOR VEHICLE REPAIR REGISTRATION #MV-04967

Date: 16 Sep 2025

Customer Signature : \_\_\_\_\_

Customer Work  
Order



Customer #: 93064  
BLAZER, CARROLL

