

FOREST RIVER WARRANTY CLAIM FORM

DEALER ACCOUNT # 0049080
 TRI AM RV CENTER OF EAST TN
 1202 IDELL ROAD (I-81 EXIT 23)
 BULLS GAP, TN 37711
 USA

CLAIM STATUS Paid
 CLAIM 2391659
 CLAIM ORIGIN WEB
 ORIGINAL CLAIM ID
 VIN 4X4FVGK23S5403456
 CHASSIS VIN
 MILEAGE 0
 SITE/WAREHOUSE 081 / 081A
 ITEM # VGF341GS11-81
 DEALER RO # 25885
 CLAIM START DATE 08/05/2025
 CLAIM END DATE 08/15/2025

Labor rate: \$165.00

OWNER INFORMATION

ELIZABETH REED
 2620 CARPENTERS CHAPEL RD
 Mosheim, TN 37818
 USA

Retail Date of Purchase 07/18/2025

WARRANTY EXPIRATION DATE

07/18/2026

Claim Line Details

Labor

Line# 1	Operation Code 40-108-15-11-003648	Operational Description Molex Self Contained Power Connector - Electrical/110 Volt Interior/Repair or Replace/Electrical
---------	---------------------------------------	---

Complaint, Cause, Correction

Original Note : ashlee@dealer-advisors.com, 2025-08-05 15:04:17 :: Complaint: Slide out with fireplace has no power in any of the outlet Cause: Due to factory defect, the molex connector going to slide is faulty Correction: Remove foam underbelly, bring out 110 wires, replace molex for slide room, reinstall wires and foam

Model#	Dlr Sub Hrs	1.00	Sub Labor Amt	\$165.00
Serial#	Appr Hrs	0.50	Appr Labor Amt	\$82.50

Notes

Dealer has requested more time than what is normally approved for this repair. Forest River will allow .50hr for this repair. If you have questions about the approved time, please contact me directly to discuss. Thank you

Part

Line# 1	Item # USERPART	Description Connector, 110 volt molex crossover connector, yellow larger round 12 gauge SJ wire	
	Model #	Serial #	Part tag
	Sub Qty 1.00	Sub Dlr Price \$7.84	Sub Freight \$0.00
	Appr Qty 1.00	Appr Dlr Price \$7.84	Appr Freight \$0.00

Notes

Line# 2	Item # USERPART	Description Great stuff gap filler	
	Model #	Serial #	Part tag
	Sub Qty 1.00	Sub Dlr Price \$5.99	Sub Freight \$0.00
	Appr Qty 1.00	Appr Dlr Price \$5.99	Appr Freight \$0.00

Notes

Labor

Line# 2	Operation Code 40-108-24-11-001334	Operational Description 110 Volt Interior Wiring - Electrical/110 Volt Interior/Repair/Electrical
---------	---------------------------------------	--

Complaint, Cause, Correction

Original Note : ashlee@dealer-advisors.com, 2025-08-05 15:06:26 :: Complaint: LP detector wired backwards Cause: During installation, factory installed 12vdc hot to ground and ground to hot Correction: Rewire detector

Model# 1	Dlr Sub Hrs	0.30	Sub Labor Amt	\$49.50
----------	-------------	------	---------------	---------

