



Phone: (423) 235-1167
 Toll Free: (877) 635-1167
 Fax: (423) 235-1176

1202 Idell Road
 Bulls Gap, TN 37711

W/O: 25916



WO #: 25916

Customer: 92301 - BARRY, DENISE
 Address: 37876 2768 MEADOW CREST LN
 SEVIERVILLE, TN

Home Phone: (865) 850-1172

Work Phone:
 Author: S.DAVIS

Location: IH
 Invoice #:

Stock #: 11049
 Stock Desc: 2025 DT KZ-RV SPORTSMEN 362DB
 Model: 362DB
 Serial #: 4EZTS3725S5107484
 Chassis #:
 Mileage:
 Key #:
 Req'n #:
 License #:
 Trim:

Purchase Date: 26 MAR 25
 Date In: 13 AUG 25
 Promise Date:
 Promise Time:
 Schedule Date:
 Completed: 19 MAR 26
 Warr. Date: 26 MAR 25

Job #1 - Warranty

COMPLAINT: TOILET WILL NOT FLUSH

CORRECTION: NO WORK PREFORMED

Subtotal for Job #1: 0.00

Job #2 - Warranty

COMPLAINT: WALL PAPER COMING LOOSE

CORRECTION: NO WORK PREFORMED

Subtotal for Job #2: 0.00

Job #3 - Warranty

COMPLAINT: SCREEN DOOR INTO IS DAMAGED AND WILL NOT CLOSE CORRECTLY

CAUSE: SCREEN DOOR IS BOWED VERY BADLY AND COMING APART. DOOR IS FAULTY.

CORRECTION: REPLACE SCREEN DOOR
 LABOR .30

Labor

Job #	Description	Hours	Total
3	REPLACED SCREEN	0.20	35.00

Parts

Part #	Description	Qty	Price	Total
505219	DOOR,SCREEN,26X72, 8000 R 26 X 72 RH STDSCDBK BKP STD LATCH (FOR 161128)	1.00	154.70	154.70

Subtotal for Job #3: 189.70

Job #4 - Warranty

COMPLAINT: RUST DEVELOPED ON THE FRONT WHERE YOU TOW

CAUSE: RUST DEVELOPED ON FRONT OF UNIT

CORRECTION: DENIED
 MAINT FOR OWNER

Customer #: 92301
 BARRY, DENISE



Labor			
Job #	Description	Hours	Total
4	RESECURED STRAP	0.10	17.50
Subtotal for Job #4:			17.50

Job #5 - Warranty

COMPLAINT: HOLES IN MOLDING WHERE LIGHTS ARE OVER COUCH

CORRECTION: NO WORK PREFORMED

Subtotal for Job #5: 0.00

Job #6 - Warranty

COMPLAINT: GOLD STRIP IS LOOSE

CAUSE: GOLD STRIP ON SLIDE FASCIA HAS WORKED LOOSE AND FALLING OFF

CORRECTION: RESECURE STRIP BACK IN PROPER PLACE
LABOR .10

Labor			
Job #	Description	Hours	Total
6	RESECURED IN PLACE	0.10	17.50
Subtotal for Job #6:			17.50

Job #7 - Warranty

COMPLAINT: BACK SPLASH IN THE KITCHEN IS CHIPPING AND LEAVING HOLES

CAUSE: BACK SPLASH MATERIAL IS CHIPPING OFF

CORRECTION: REMOVE AND REPLACE BACK SPLASH
LABOR .50

Labor			
Job #	Description	Hours	Total
7	REPLACED	0.50	87.50

Parts				
Part #	Description	Qty	Price	Total
165829	PANEL TIFFANY WHITE 48X96	1.00	185.93	185.93
Subtotal for Job #7:				273.43

Job #8 - Warranty

COMPLAINT: SCREEN ON SLIDING DOOR DOES NOT CLOSE CORRECT,DENTED AND SCREWS ARE CHIPPED

CAUSE: THE SIDING ON SIDES OF THE SLIDING DOOR BOWING OUT. METAL IS NOT CUT TO FIT CORRECTLY. THIS HAS CAUSED THE DOOR TO BECOME DAMAGED AS WELL.

CORRECTION: REMOVE COMPLETE SLIDING DOOR AND TRACK, REPAIR OPENING SO THE TRACK HOUSING FITS CORRECTLY, INSTALL NEW TRACK HOUSING,NEW SCREEN DOOR AND RESEAL AREA
LABOR 3.5

Labor			
Job #	Description	Hours	Total
8	REPAIRED AND REPLACED	3.50	612.50

Parts				
Part #	Description	Qty	Price	Total



Customer #: 92301
BARRY, DENISE



141859	DOOR,PATIO,SLIDING,BLACK,5' WIDE X6' HIGH,XO,KINRO	1.00	1,039.61	1,039.61
38-1636	BUTYL TAPE 1"	1.00	8.35	8.35
38-1870	PROFLEX SEALANT CLR 10OZ	1.00	11.86	11.86

Other Services

Code	Description	Qty	Price	Total
CRA	CRATE CHARGES	1.00	50.00	50.00
FRT	FREIGHT ON PARTS	1.00	335.00	335.00

Subtotal for Job #8: 2,057.32

Job #10 - Warranty

COMPLAINT: KITCHEN FAUCET IS LEAKING

CAUSE: FAUCET IS LEAKING AT THE BASE, FAULTY FAUCET

CORRECTION: REPLACE KITCHEN FAUCET AND TEST
LABOR .50

Labor

Job #	Description	Hours	Total
10	REPLACED KITCHEN FAUCET	0.50	87.50

Parts

Part #	Description	Qty	Price	Total
163737	FAUCET,KITCHEN,BLACK MATTE.W/SPRING & PULL-DOWN HEAD W/TOGGLE,8"	1.00	110.58	110.58

Subtotal for Job #10: 198.08

Job #11 - Warranty

COMPLAINT: HOLES IN THE VALANCE IN LIVING ROOM

CORRECTION: NO WORK PREFORMED

Subtotal for Job #11: 0.00

Job #12 - Warranty

HOLES VALANCE IN BEDROOM HAS HOLES

Subtotal for Job #12: 0.00

Job #13 - Warranty

COMPLAINT: SLIDING DOOR SIDE LOWER METAL HAS DEVELOPED WAVES ON THEM

CAUSE: LOWER METAL IS FAULTY AND DEVELOPING WAVES, SCREWS WERE OVER TIGHTENED
AT FACTORY INSTALL

CORRECTION: REMOVE ALL LOWER METAL AND TRIM THAT IS DAMAGED AND REPLACE WITH
NEW. STEPS WILL NEED TO BE REMOVED AND REINSTALLED AS WELL.
LABOR 3.0

Labor

Job #	Description	Hours	Total
13	REPLACED METAL	3.00	525.00

Parts

Part #	Description	Qty	Price	Total
138706	METAL,ALUMINUM,BLACK,030,12X156 ,D-11,RADIUS	1.00	96.02	96.02



Customer #: 92301
BARRY, DENISE



Subtotal for Job #13: 621.02

Job #14 - Warranty

COMPLAINT: WATER RUNNING DOWN FRONT OF UNIT WHERE THE RAIN GUTTERS MEET

CAUSE: THERE IS NOT THE CORRECT AMOUNT OF SEALANT IN THIS AREA ALLOWING WATER TO COME DOWN THE FRONT

CORRECTION: RESEAL AREA
LABOR .20

Labor

Job #	Description	Hours	Total
14	RESEAL AREA	0.20	35.00

Subtotal for Job #14: 35.00

Job #15 - Warranty

COMPLAINT: SHOWER RUBBER CORNER SEAL IS LOOSE AND COMING OFF

CAUSE: RUBBER SEAL IS NOT STAYING IN PLACE AND TECH STATED THE SEAL WILL NOT LAY BACK IN PLACE AS DESIGNED

CORRECTION: REMOVE THE FAULTY SHOWER SEAL AND REPLACE WITH NEW SEAL
LABOR 1.0

Labor

Job #	Description	Hours	Total
15	REPLACED SEAL	0.50	87.50

Other Services

Code	Description	Qty	Price	Total
NII	SHOWER SEAL	1.00	10.99	10.99

Subtotal for Job #15: 98.49

Job #16 - Warranty

COMPLAINT: COMPARTMENT KEY LOCK IS SPINNING AND NOT ALLOWING CUSTOMER TO LOCK/UNLOCK DOOR

CAUSE: COMPARTMENT TUMBLER IS FAULTY AND WILL NOT WORK

CORRECTION: REMOVE FAULTY TUMBLER AND REPLACE WITH NEW
LABOR .30

Labor

Job #	Description	Hours	Total
16	REPLACED TUMBLER	0.10	17.50

Parts

Part #	Description	Qty	Price	Total
155260	CYLINDER,KEY, NONMASTER, F/388, W/O KEYS	1.00	3.90	3.90

Subtotal for Job #16: 21.40

W/O: 25916



Customer #: 92301
BARRY, DENISE



Parts Total: 1,610.95
Labour Total: 1,522.50
Sublet Total: 0.00
Extras Total: 395.99
WORK ORDER TOTAL: 3,529.44

W/O: 25916

I HEREBY ACCEPT ABOVE DESCRIBED WORK AS SATISFACTORY & COMPLETE TO MY SATISFACTION.

X

MOTOR VEHICLE REPAIR REGISTRATION #MV-04967

Date: 19 Mar 2026

Customer Signature : _____

Customer Work Order



Customer #: 92301
BARRY, DENISE

