



Phone: (423) 235-1167
 Toll Free: (877) 635-1167
 Fax: (423) 235-1176

1202 Idell Road
 Bulls Gap, TN 37711

W/O: 26371



WO #: 26371 (Appointment Date: 10 NOV 2025 - Time: 03:00pm)

Customer: 93399 - WEBB, JOHN
 Address:

Home Phone: 276-275-4536

Work Phone:
 Author: S.DAVIS
 Location: IH
 Invoice #:

Stock #:
 Stock Desc: 2025 TT FOREST RIVER EAST TO
 WEST
 Model:
 Serial #: 5ZT2DERB2S9015465
 Chassis #:
 Mileage:
 Key #:
 Req'n #:
 License #:
 Trim:

Purchase Date:
 Date In: 10 NOV 25
 Promise Date:
 Promise Time:
 Schedule Date:
 Completed:
 Warr. Date:

Job #1 - Warranty

COMPLAINT: SEVERAL OF THE LIGHTS THAT HAVE THE BUTTON IN THE MIDDLE ARE VERY HARD TO PUSH TO GET ON. THESE ARE IN THE BEDROOM AND ON THE SLIDE OUT

CAUSE: BOTH LIGHTS ON THE SLIDE OUT WILL NOT WORK AS DESIGNED, FAULTY LIGHTS.

CORRECTION: REPLACE THE TWO ROUND LIGHTS ON THE MAIN SLIDE OUT
 LABOR FOR BOTH .40

Subtotal for Job #1: 0.00

Job #2 - Warranty

COMPLAINT: RUST ON THE FRAME WHERE THE JACKS ARE AND OTHER AREAS UNDERNEATH

CAUSE: RUST HAS DEVELOPED ALONG THE FRONT SIDE OF THE FRAME BY THE STAB JACK

CORRECTION: CLEAN AND REPAINT THE RUSTED AREA
 LABOR .50

Subtotal for Job #2: 0.00

Job #3 - External

CUST HAS A EXTRA PANEL WHERE HIS PANEL IS THAT SHOWS TANK LEVELS, CUST WOULD LIKE TO KNOW WHAT THAT PANEL IS FOR AT PICK UP

Other Services

Code	Description	Qty	Price	Total
SSE	SHOP SUPPLIES EXTERNAL	1.00	0.00	0.00

Subtotal for Job #3: 0.00

Job #4 - External

CUST HAS A TRIP RIGHT BEFORE THANKSGIVING

Subtotal for Job #4: 0.00

Job #5 - Warranty

COMPLAINT: INSULATION COMING OUT FRONT AND BACK CHECK AND ADVISE

CAUSE: SPRAY FOAM INSULATION IS PROTRUDING FROM UNDERBELLY OF UNIT

CORRECTION: CUT OFF AND REMOVE THE EXCESSIVE FOAM

Customer #: 93399
 WEBB, JOHN



LABOR .50

Subtotal for Job #5: 0.00

Job #6 - Warranty

COMPLAINT: BACK DOORSIDE CORNER CAULKING ON ROOF IS CRACKING CHECK AND ADVISE

CAUSE: TECH VERIFIED THE SEALANT ON THE BACK CORNER HAS OPEN VOIDS AND ALLOWING MOISTURE AND WATER IN THESE AREAS

CORRECTION: CLEAN AND RESEAL THE NEEDED AREA ON THE ROOF

LABOR .50

Subtotal for Job #6: 0.00

Job #7 - Warranty

COMPLAINT: DOOR SIDE AWNING RAIL SPLIT IS NOT CAULKED CHECK AND ADVISE

CAUSE: GUTTER RAIL IS NOT SEALED WHERE IT MEETS AT AND ALLOWING WATER TO RUN DOWN THE SIDE OF THE UNIT

CORRECTION: CLEAN AND RESEAL THE GUTTER RAIL

LABOR .40

Subtotal for Job #7: 0.00

Job #8 - Warranty

COMPLAINT: FRONT DOORSIDE CORNER AT GUTTER SPOUT SEALANT LOOKS BAD CHECK AND ADVISE

CAUSE: FOUND OPEN VOIDS IN THE SEALANT ALLOWING MOISTURE AND WATER IN THE CORNERS OF THE UNIT

CORRECTION: CURRENT SEAL NEEDS TO BE REMOVED, AREA CLEANED AND NEW SEALANT APPLIED TO THE AREAS

LABOR 1.0

Subtotal for Job #8: 0.00

Job #9 - Warranty

COMPLAINT: LARGE SLIDE IS DROPPED DOWN IN THE MIDDLE WHEN LOOKING AT ROOF, CHECK AND ADVISE

CAUSE: TOP SLIDE SEAL ON MAIN SLIDE DROPS DOWN AT OR NEAR THE CENTER POINT. SEAL NOT STAYING IN CORRECT PLACE.

CORRECTION: REPLACE THE SLIDE SEAL ON THE TOP OF THE MAIN SLIDE OUT. THE SLIDE TOPPER WILL NEED TO BE REMOVED AND REINSTALLED TO DO THIS JOB

LABOR 2.5

Subtotal for Job #9: 0.00

Job #10 - Warranty

COMPLAINT: WHEN SLIDE IS OUT ON LARGE SLIDE THE FRONT SEALS TOUCH, THE REAR SEALS DO NOT, CHECK AND ADVISE

CAUSE: RIGHT SIDE SEAL ON MAIN SLIDE IS VERY TIGHT WHILE LEFT SIDE SEAL DON'T TOUCH SLIDE.

CORRECTION: NEED TO LOOSEN SLIDE FROM MOUNTS AND SHIFT OVER 1.5" TO ALIGN PROPERLY AND CORRECT CONCERN

LABOR 1.5

W/O: 26371



Customer #: 93399
WEBB, JOHN



Subtotal for Job #10: 0.00

W/O: 26371

Parts Total: 0.00

Labour Total: 0.00

Sublet Total: 0.00

Extras Total: 0.00

WORK ORDER TOTAL: 0.00

I HEREBY ACCEPT ABOVE DESCRIBED WORK AS SATISFACTORY & COMPLETE TO MY SATISFACTION.
X

MOTOR VEHICLE REPAIR REGISTRATION #MV-04967

Customer Signature : _____

Date: 14 Nov 2025



Customer Work Order

Customer #: 93399
WEBB, JOHN

