



600 E. Baseline Rd.  
Evansville, IN 47725

www.AmericanRVCenter.com

812.867.5200  
FAX 812.868.1012

W/O: 67929  
Promised Date: 30 JUL 22

## CUSTOMER WORK ORDER

WO #: 67929

Customer: 1000 - BASDEN'S AMERICAN  
RV -  
Tag:  
Author: BH  
Location: 1006 SEE IF BH GOT EXTRA  
HOURS APPROVED

Stock #: 11169  
Stock Desc: 2022 5W KEYSTONE  
MONTANA 3121RL  
Chassis #: 4YDFM0R2XN4702830  
Serial #: 4YDFM0R2XN4702830  
Mileage: 0  
Licence:

Invoice #:  
Date In: 09 JUL 22  
Promised: 30 JUL 22  
Date Sched:  
Completed: 30 SEP 22  
Warr. Date:

### Job #1 - Warranty

COMPLAINT: UNIT HAS A LEAK ON THE DOORSIDE REAR SLIDE FIND WHERE IT IS SOMING FROM  
AND ORDER THE PARTS AND FIX

CAUSE: Transition strip located behind the front top fascia on the slide out is not sealed and is allowing water to roll behind and underneath it and seep into the slide out ceiling. Slide out ceiling panels and batten strips have excessive water damage and need to be replaced. Kitchen table also has water damage and needs to be replaced. One of the LED lights above the recliners has water inside of it and is beginning to fail. Næed to seal transition strip, test for leaks and replace all materials listed.


CORRECTION: Pulled unit into shop. Removed recliners and kitchen chairs from slide out. Removed all that and strips and the top fascia trim from slide out. Removed two lights over recliners and light fixture over kitchen table. Removed all the valances and blinds from slide out room. Removed hardware for blinds in order to gain access to Corner trim and Crown molding. Remove Corner trim and crown molding. Cut panels along the edge and remove them from the top of the slide out. Removed all insulation that fell out and was not secured. Cleaned area and install new insulation with spray adhesive. Cut new bat and strips to link. Removed Staples from crown molding and Corner trim. Took new ceiling panels and cut to length. Measured for Access holes for the lights on panels. Cut holes with a hole saw. Installed bracing on the side of the slide out wall to help hold the ceiling panel in place. Installed ceiling panel and rim wires through the holes. Installed batting strips on the sides and the top. Installed Crown molding in corner trim. Installed another small piece of paneling in between the other two that I cut. Added to pieces of battened strip to those to hide the seams. Installed top fascia trim. Installed hardware for blinds. Installed blinds. Installed the valances over blinds. Installed light fixture over table and installed 2 new lights over recliners. Applied putty to staple holes as needed. Kitchen table also needs replaced. Got new table out of Parts trailer. Removed tabletop. Installed new table top. Installed recliners. Put kitchen chairs back. Cleaned up mess.

### Labor

| Code | Description          | Mechanic | Total  |
|------|----------------------|----------|--------|
| Z990 | MISCELLANEOUS REPAIR | ZMS      | 0.00   |
| Z990 | MISCELLANEOUS REPAIR | ZMS      | 150.00 |
| Z990 | MISCELLANEOUS REPAIR | ZMS      | 0.00   |
| Z990 | MISCELLANEOUS REPAIR | ZMS      | 0.00   |
| Z990 | MISCELLANEOUS REPAIR | ZMS      | 280.50 |
| Z990 | MISCELLANEOUS REPAIR | ZMS      | 225.00 |
| Z990 | MISCELLANEOUS REPAIR | ZMS      | 244.50 |
| Z990 | MISCELLANEOUS REPAIR | ZMS      | 0.00   |
| Z990 | MISCELLANEOUS REPAIR | ZMS      | 300.00 |
| Z990 | MISCELLANEOUS REPAIR | ZMS      | 300.00 |

### Parts

| Part # | Description                                                                     | Qty  | Price | Total |
|--------|---------------------------------------------------------------------------------|------|-------|-------|
| 500627 | CLEAR SIKASIL PLUS                                                              | 2.00 | 17.86 | 35.72 |
| 479576 | Light - Ceiling - Round - 4 1/2" - 12V -<br>LED - Mushroom Light - Ultra Bright | 1.00 | 2.60  | 2.60  |

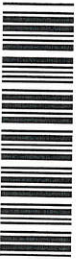

Customer #: 1000  
BASDEN'S AMERICAN RV,



W/O: 67929  
Promised Date: 30 JUL 22

|        |                                                                              |      |        |        |
|--------|------------------------------------------------------------------------------|------|--------|--------|
| 479579 | LED - Mushroom Light - Ultra Bright - w/Switch                               | 1.00 | 2.86   | 2.86   |
| 681071 | Panel - 3.6mm x 48" x 96" - Carb 2 - LN - Bermuda Arctic                     | 2.00 | 60.94  | 121.88 |
| 681067 | Trim - Batten - 3.6mm x 1 1/2" x 96" - Carb 2 - LN - BEV 2S - Bermuda Arctic | 4.00 | 3.13   | 12.52  |
| 640776 | Trim - Batten - 3.6mm x 1 7/8" x 96" - Carb 2 - LN - Square - Modern Maple   | 4.00 | 4.08   | 16.32  |
| 655452 | DINETTE TABLE 26 x 38.5 W/10" LEAF                                           | 1.00 | 314.42 | 314.42 |

#### Other Services

| Code  | Description                             | Qty  | Price  | Total  |
|-------|-----------------------------------------|------|--------|--------|
| FRT   | UPS LIGHTS                              | 1.00 | 11.76  | 11.76  |
| FRT   | FREIGHT & CRATE - PANELING, TRIM, TABLE | 1.00 | 157.97 | 157.97 |
| PARTS | 654976 ROLLED INSULATION                | 1.00 | 24.59  | 24.59  |

**Subtotal for Job #1: 2,200.64**

Parts Total: 506.32  
Labour Total: 1,500.00  
Sublet Total: 0.00  
Extras Total: 194.32  
**WORK ORDER TOTAL: 2,200.64**

Thank you for being a valued customer. We appreciate your business.

All labor is guaranteed for 90 days from invoice date. Guarantee is limited to work performed. Consequential damages are not covered. All guaranteed work must be completed in our service department.

Customer Signature : \_\_\_\_\_

Date: 07 Oct 2022

Customer #: 1000  
BASDEN'S AMERICAN RV,

