



600 E. Baseline Rd.  
Evansville, IN 47725

www.AmericanRVCenter.com

812.867.5200  
FAX 812.868.1012

W/O: 69915  
Promised Date:

### CUSTOMER WORK ORDER

WO #: 69915  
Customer: 1000 - BASDEN'S  
AMERICAN RV -  
Tag:  
Author: BH  
Location: 0325 CHECK WORK

Stock #: 11117  
Stock Desc: 2023 TT COACHMEN  
CATALINA 263BHSCLE  
Chassis #: 5ZT2CARB0PU040963  
Serial #: 5ZT2CARB0PU040963  
Mileage: 0  
Licence:

Invoice #:  
Date In: 23 FEB 23  
Promised: 28 FEB 23  
Date Sched:  
Completed: 22 MAR 23  
Warr. Date:



#### Job #1 - Warranty

COMPLAINT: REAR WALL PAPER LOOSE

CAUSE: REAR WALL BY TOP BUNK PAPER IS PEELING AND LOSE NEEDS NEW WALL

CORRECTION: REAR WALL BY TOP BUNK PAPER IS PEELING AND LOSE NEEDS NEW WALL  
REMOVE MATTRESS. REMOVE UPPER BUNK. CUT OUT DAMAGED PANEL. PUT BLOCKING IN  
WHERE NEEDED. CUT NEW PANEL AND INSTALL. PUT ON SEAM TAPE AND BATON STRIPS. PUTTY  
HOLES. PUT BUNK BACK AND MATTRESS

Labor Code	Description	Mechanic	Total
Z990	MISC LABOUR CODE (EXTERNAL)	BB	825.60
Z990	MISC LABOUR CODE (EXTERNAL)	RAB	0.00
Z990	MISC LABOUR CODE (EXTERNAL)	BB	134.40

Parts Part #	Description	Qty	Price	Total
F100176333	WALL BOARD	32.00	1.46	46.72

Other Services Code	Description	Qty	Price	Total
FRT	FREIGHT	1.00	300.85	300.85

**Subtotal for Job #1: 1,307.57**

#### Job #2 - Warranty

COMPLAINT: BED ROOM TO LR DOOR WONT SHUT

CAUSE: BEDROOM TO LIVING ROOM DOOR WOULDNT SHUT DUE TO STRIKING PLATE BEING TO FAR BACK. STRIKING PLATE NEEDED MOVED UP. UNSCREWED STRIKE PLATE AND MOVED UO ABOUT A 1/4 OF IN REATTCAHED SCREWS AND TESTED

CORRECTION: BEDROOM TO LIVING ROOM DOOR WOULDNT SHUT DUE TO STRIKING PLATE BEING TO FAR BACK. STRIKING PLATE NEEDED MOVED UP. UNSCREWED STRIKE PLATE AND MOVED UO ABOUT A 1/4 OF IN REATTCAHED SCREWS AND TESTED

Labor Code	Description	Mechanic	Total
Z990	MISC LABOUR CODE (EXTERNAL)	RAB	48.00

**Subtotal for Job #2: 48.00**

Customer #: 1000



W/O: 69915  
Promised Date:  
28 FEB 23




Parts Total:	46.72
Labour Total:	1,008.00
Sublet Total:	0.00
Extras Total:	300.85
<b>WORK ORDER TOTAL:</b>	<b>1,355.57</b>

Thank you for being a valued customer. We appreciate your business.

All labor is guaranteed for 90 days from invoice date. Guarantee is limited to work performed. Consequential damages are not covered. All guaranteed work must be completed in our service department.

Date: 22 Mar 2023

Customer Signature : \_\_\_\_\_

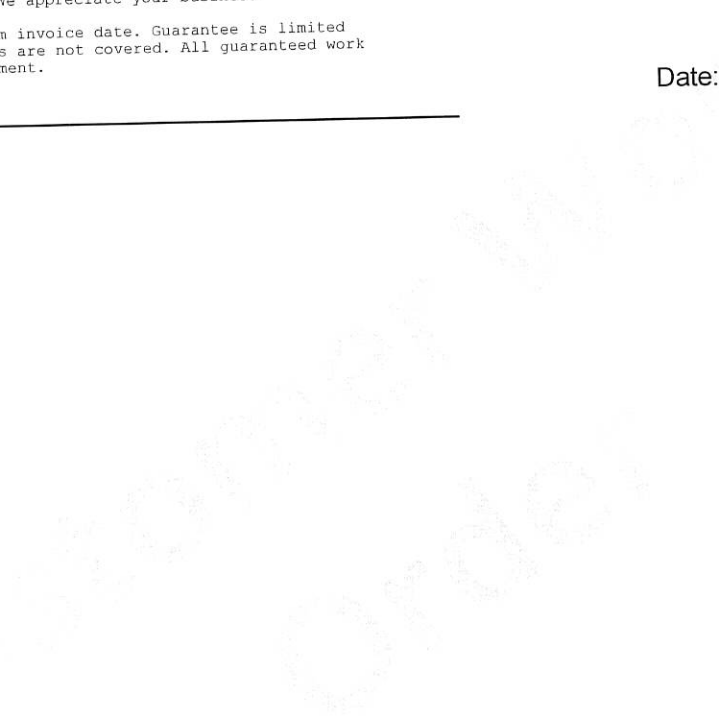

Customer #:  
1000

